

# HOME REPORT



**13 ALDER GREEN  
BOURTREEHILL NORTH  
IRVINE  
KA11 1LB**



**DM HALL**  
CHARTERED SURVEYORS



# ENERGY PERFORMANCE CERTIFICATE



**DM HALL**  
CHARTERED SURVEYORS



# Energy Performance Certificate (EPC)

# Scotland

Dwellings

13 ALDER GREEN, BOURTREEHILL NORTH, IRVINE, KA11 1LB

**Dwelling type:** Semi-detached house  
**Date of assessment:** 28 April 2022  
**Date of certificate:** 28 April 2022  
**Total floor area:** 69 m<sup>2</sup>  
**Primary Energy Indicator:** 298 kWh/m<sup>2</sup>/year

**Reference number:** 1112-4124-5000-0608-2226  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** Elmhurst  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,319	See your recommendations report for more information
Over 3 years you could save*	£672	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs



Not energy efficient - higher running costs

Current	Potential
63	85

## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (63)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO<sub>2</sub> emissions



Not environmentally friendly - higher CO<sub>2</sub> emissions

Current	Potential
58	83

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (58)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£500 - £1,500	£180.00
2 Floor insulation (suspended floor)	£800 - £1,200	£126.00
3 Increase hot water cylinder insulation	£15 - £30	£48.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, partial insulation (assumed)	★★★★☆☆	★★★★☆☆
	Cavity wall, as built, insulated (assumed)	★★★★★☆☆	★★★★★☆☆
Roof	Pitched, 100 mm loft insulation	★★★★☆☆	★★★★☆☆
	Flat, insulated (assumed)	★★★★☆☆	★★★★☆☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★★☆☆	★★★★☆☆
Main heating	Boiler and radiators, mains gas	★★★★★☆☆	★★★★★☆☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★★☆☆	★★★★★☆☆
Secondary heating	None	—	—
Hot water	From main system, no cylinder thermostat	★★★★☆☆	★★★★☆☆
Lighting	Low energy lighting in 43% of fixed outlets	★★★★☆☆	★★★★☆☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.


## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 52 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.6 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.1 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.















## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,539 over 3 years	£1,254 over 3 years	
Hot water	£498 over 3 years	£213 over 3 years	
Lighting	£282 over 3 years	£180 over 3 years	
<b>Totals</b>	<b>£2,319</b>	<b>£1,647</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Cavity wall insulation	£500 - £1,500	£60		
2 Floor insulation (suspended floor)	£800 - £1,200	£42		
3 Increase hot water cylinder insulation	£15 - £30	£16		
4 Low energy lighting for all fixed outlets	£20	£31		
5 Hot water cylinder thermostat	£200 - £400	£40		
6 Solar water heating	£4,000 - £6,000	£36		
7 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£341		

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 3 Hot water cylinder insulation

Increasing the thickness of existing insulation around the hot water cylinder will help to maintain the water at the required temperature; this will reduce the amount of energy used and lower fuel bills. An additional cylinder jacket or other suitable insulation layer can be used. The insulation should be fitted over any thermostat clamped to the cylinder. Hot water pipes from the hot water cylinder should also be insulated, using pre-formed pipe insulation of up to 50 mm thickness, or to suit the space available, for as far as they can be accessed to reduce losses in summer. All these materials can be purchased from DIY stores and installed by a competent DIY enthusiast.

### 4 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

### 5 Cylinder thermostat

A hot water cylinder thermostat enables the boiler to switch off when the water in the cylinder reaches the required temperature; this minimises the amount of energy that is used and lowers fuel bills. The thermostat is a temperature sensor that sends a signal to the boiler when the required temperature is reached. To be fully effective it needs to be sited in the correct position and hard wired in place, so it should be installed by a competent plumber or heating engineer. Building regulations apply to this work, so it is best to check with your local authority building standards department whether a building warrant will be required.

### 6 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).



## 7 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	9,072	(321)	(1,447)	N/A
Water heating (kWh per year)	3,682			

## Addendum

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Kevin Masson
Assessor membership number:	EES/020018
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	45 Bank Street Irvine KA12 0LL
Phone number:	0131 477 6000
Email address:	<a href="mailto:dmhall@dmhall.co.uk">dmhall@dmhall.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

### **Advice and support to improve this property**

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.


Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT





# SINGLE SURVEY

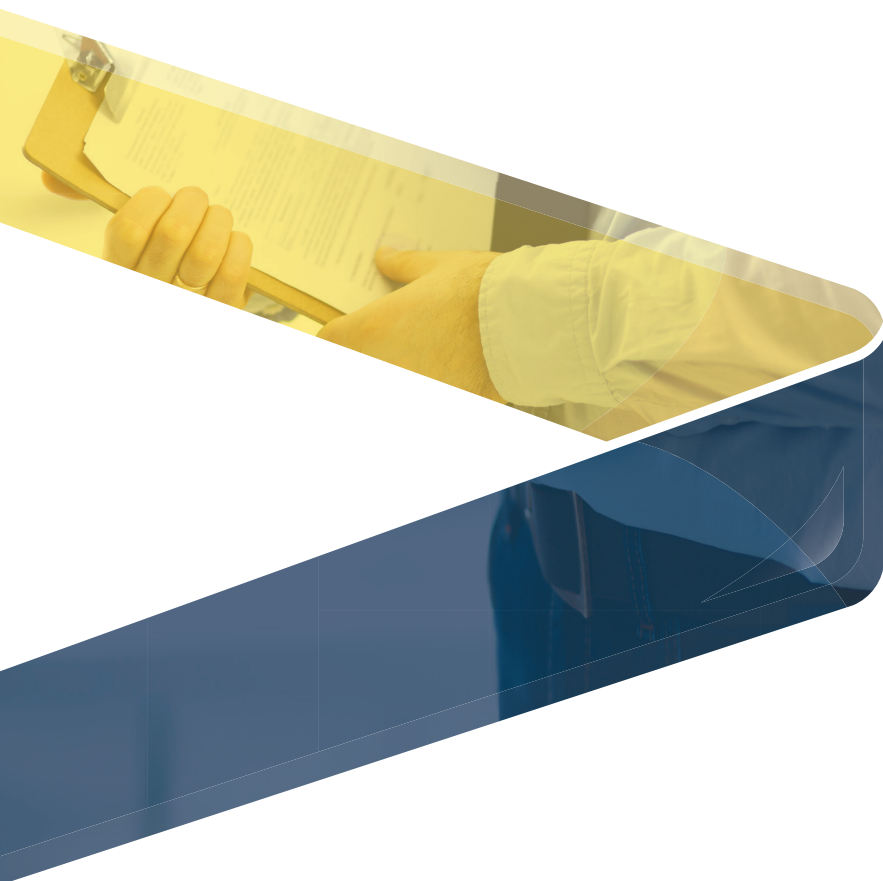

**DM HALL**  
CHARTERED SURVEYORS



# Single Survey

survey report on:

Property address	13 ALDER GREEN BOURTREEHILL NORTH IRVINE KA11 1LB
Customer	Mrs Janice Kerr
Customer address	
Prepared by	DM Hall LLP
Date of inspection	28th April 2022



## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☒

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.



# Terms and Conditions

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report<sup>2</sup> will be from information contained in the Report and the generic Mortgage Valuation Report.

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

# Terms and Conditions

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

### **WARNING:**

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

<b>Description</b>	A semi-detached two storey villa.
<b>Accommodation</b>	GROUND FLOOR:- Entrance Vestibule, Lounge, Kitchen and Dining Room.  FIRST FLOOR:- Landing, Two Bedrooms and Bathroom.
<b>Gross internal floor area (m<sup>2</sup>)</b>	Approximately 69 square metres.
<b>Neighbourhood and location</b>	The property is situated within an established residential area where surrounding properties are of a similar age and style. Local amenities can be found within a reasonable commute.
<b>Age</b>	Built circa 1980 (42 years old).
<b>Weather</b>	Overcast but dry. Weather over recent weeks has been unsettled.
<b>Chimney stacks</b>	None.
<b>Roofing including roof space</b>	<p><b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</b></p> <p><b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b></p> <p><b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b></p> <p>The roof is of pitched design and is overlaid with tiles with a tiled</p>

# Single Survey

	<p>ridge.</p> <p>The roof over the gable extension is flat and overlaid with felt or a similar material.</p> <p>I was able to gain a view of the roof structure via a ceiling hatch from the first floor landing. The roof is of timber truss construction with fibreboard sarking. Glass wool insulation has been laid in between the ceiling joists.</p>
<b>Rainwater fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>Gutters and downpipes are formed in PVC materials.</p>
<b>Main walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The outer walls appear to be of cavity brick construction with a rendered finish.</p>
<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>Access to the property is via PVC and glazed doors to the entrance vestibule, kitchen and dining room.</p> <p>The subjects are fitted with uPVC double glazed windows.</p> <p>Fascia and soffit boards are formed in timber.</p>
<b>External decorations</b>	<p>No significant external decoration.</p>
<b>Conservatories / porches</b>	<p>None.</p>
<b>Communal areas</b>	<p>None.</p>
<b>Garages and permanent outbuildings</b>	<p><b>Visually inspected.</b></p> <p>There is an attached single garage.</p>

# Single Survey

<b>Outside areas and boundaries</b>	<b>Visually inspected.</b>  Garden grounds are laid to lawn and hard landscaped. These are bounded by timber fencing and brick walls.
<b>Ceilings</b>	<b>Visually inspected from floor level.</b>  Assumed to be dry lined with plasterboard sheets.
<b>Internal walls</b>	<b>Visually inspected from floor level.</b>  <b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b>  Dry lined with plasterboard sheets.
<b>Floors including sub floors</b>	<b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b>  Flooring appears to be of suspended timber overlaid with what I have assumed to be tongue and groove boarding.
<b>Internal joinery and kitchen fittings</b>	<b>Built-in cupboards were looked into but no stored items were moved.</b>  <b>Kitchen units were visually inspected excluding appliances.</b>  There are floor and wall mounted units within the kitchen.  Internal doors are of timber and glazed design.
<b>Chimney breasts and fireplaces</b>	None.
<b>Internal decorations</b>	<b>Visually inspected.</b>  Generally painted and papered with tiling in the kitchen and bathroom.
<b>Cellars</b>	None.
<b>Electricity</b>	<b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b>  Mains supply. The consumer unit and meter are located within the entrance vestibule. Visible wiring is of PVC coated cabling and there are electrical sockets throughout.




# Single Survey

<b>Gas</b>	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply. The meter is assumed to be located in an external box.</p>
<b>Water, plumbing, bathroom fittings</b>	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Mains supply. Visible pipework is of copper and PVC materials.</p> <p>The bathroom comprises a standard three piece suite with an electric shower over the bath.</p>
<b>Heating and hot water</b>	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Space heating is provided by a gas fired system of radiators throughout. The system is fired by the 'Baxi' boiler which is located within the kitchen. There is also a hot water storage cylinder located within the garage.</p>
<b>Drainage</b>	<p>Drainage covers etc. were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is assumed to be connected to the main sewer.</p>
<b>Fire, smoke and burglar alarms</b>	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Smoke detectors have been installed but not tested.</p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.</p>

<p><b>Any additional limits to inspection</b></p>	<p>At the time of inspection, the property was occupied, fully furnished with a variety of fitted and fixed floor coverings in place. Furnishings, personal items (particularly in cupboards) and floor coverings have not been moved.</p> <p>My inspection of cupboards and most apartments was limited due to a high volume of furnishings and stored items.</p> <p>I was unable to gain entry to the dining room.</p> <p>Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate, however this was limited due to a high volume of furnishings and stored items restricting access.</p> <p>Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.</p> <p>My inspection of the roof space was restricted to a head and shoulders inspection and was generally limited to the area around the access only. My overall inspection was further restricted due to insulation materials. These have not been disturbed.</p> <p>No sub-floor inspection was possible.</p> <p>My inspection of the garage was severely limited due to a high volume of stored items within.</p> <p>I was unable to view the flat roof over the garage.</p> <p>I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.</p> <p>The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.</p> <p>Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.</p> <p>The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.</p>
---	---

## Sectional Diagram showing elements of a typical house

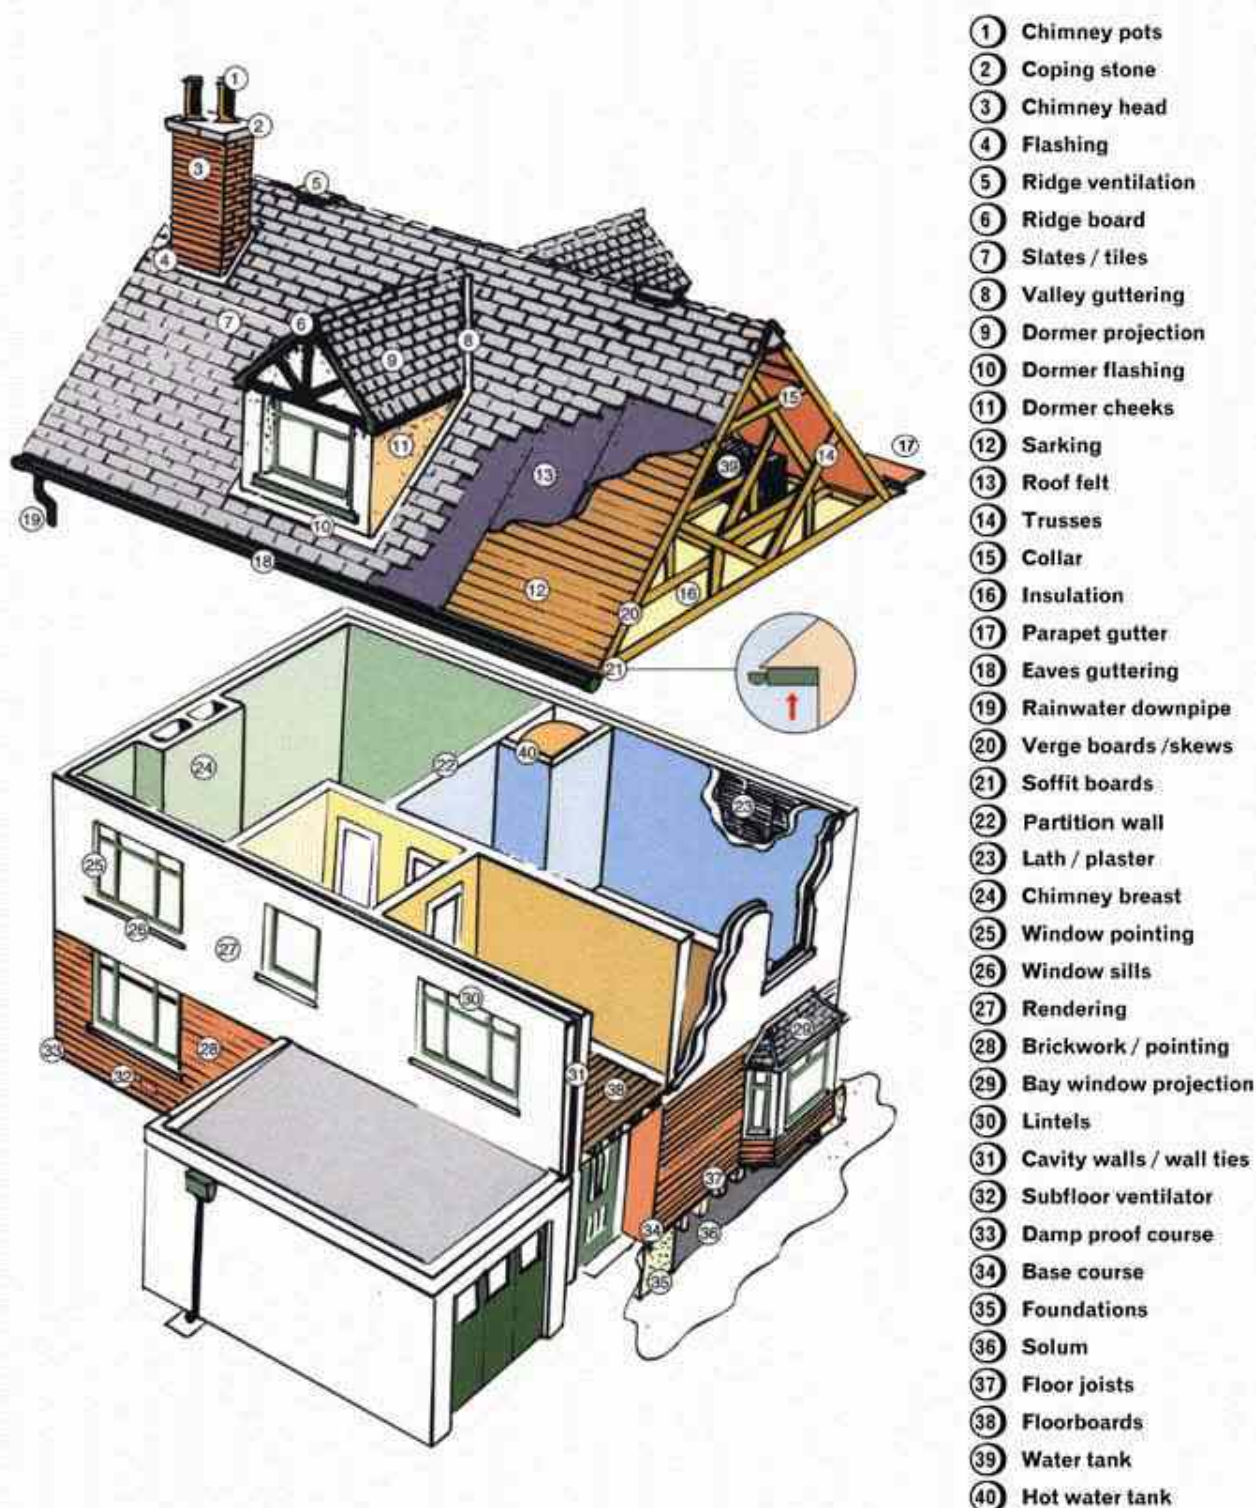


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


# Single Survey

## 2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

 Dampness, rot and infestation	
Repair category	1
Notes	No obvious evidence of significant dampness, rot or wood boring insect infestation.

 Chimney stacks	
Repair category	-
Notes	Not applicable.

 Roofing including roof space	
Repair category	2
Notes	<p>General weathering and moss growth was noted to the roof tiles.</p> <p>Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectancy around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair/replacement costs.</p> <p>The flat felt roof covering over the gable extension has a limited life expectancy and can fail without warning. Inspection at close quarters may reveal further deterioration/damage to roofing materials, especially where these are original. A reputable roofing contractor will be able to provide further advice.</p> <p>Loose and damaged sarking boards were evident in the roof space.</p>

# Single Survey



## Rainwater fittings

Repair category	1
Notes	No significant defects evident.



## Main walls

Repair category	2
Notes	Cracked and damaged render was noted.



## Windows, external doors and joinery

Repair category	2
Notes	<p>The window units are of an older type. The seals to older double glazed units often fail resulting in condensation between the panes of glass. Failed sealed units can go undetected in certain weather/daylighting conditions and such failings are not considered to be significant because the window remains functional albeit not as double glazing. This can occur without warning and may only be seen in certain weather conditions.</p> <p>The seals to a number of the double glazed window units have already failed resulting in condensation between the panes of glass.</p> <p>General weathering and decay was noted fascia/soffit boards.</p>



## External decorations

Repair category	-
Notes	Not applicable.



## Conservatories/porches

Repair category	-
Notes	Not applicable.



## Communal areas

Repair category	-
Notes	Not applicable.





## Garages and permanent outbuildings

<b>Repair category</b>	2
<b>Notes</b>	<p>Damaged, loose and stained sarking boards were evident within the garage.</p> <p>Some repair work and possible replacement is required to the garage door.</p> <p>Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair/replacement costs.</p> <p>Water staining was evident to walls within the garage however, I was unable to test these areas and the situation will require to be monitored.</p>



## Outside areas and boundaries

<b>Repair category</b>	2
<b>Notes</b>	Garden grounds appear generally well presented however, cracked and leaning boundary walls were evident.



## Ceilings

<b>Repair category</b>	1
<b>Notes</b>	<p>Surface cracking was noted.</p> <p>The textured finishes may contain asbestos based material. See information on Asbestos in the Limitations of Inspection section above.</p>



## Internal walls

<b>Repair category</b>	1
<b>Notes</b>	The textured finishes may contain asbestos based material. See information on Asbestos in the Limitations of Inspection section above.



## Floors including sub-floors

<b>Repair category</b>	2
<b>Notes</b>	<p>Loose and creaking flooring was noted.</p> <p>There is deflection to flooring within an upstairs bedroom suggesting the possibility of concealed defects. Investigation, including examination of concealed areas, should be carried out by a suitably qualified contractor, and any necessary repairs implemented to guaranteed standards</p> <p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.</p>



## Internal joinery and kitchen fittings

Repair category	2
Notes	<p>A degree of wear and tear was noted to the kitchen units.</p> <p>Glazed inserts to interior doors may not be of appropriate toughened glass or meet the recognised Building Standards.</p>



## Chimney breasts and fireplaces

Repair category	-
Notes	Not applicable.



## Internal decorations

Repair category	1
Notes	No significant defects evident.



## Cellars

Repair category	-
Notes	Not applicable.



## Electricity

Repair category	1
Notes	<p>The consumer unit appears to be formed in PVC materials which may no longer comply with the most up to date Building Regulations.</p> <p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p>



## Gas

Repair category	1
Notes	Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.



## Water, plumbing and bathroom fittings

<b>Repair category</b>	2
<b>Notes</b>	<p>Mould growth and gaps were evident to the seal around the bath.</p> <p>Damage was evident to the bath panel.</p> <p>It should be appreciated that seals around bath/shower areas and sanitary fittings can be troublesome and do require regular maintenance. Failure to seals can result in dampness/decay to adjoining/underlying areas.</p>



## Heating and hot water

<b>Repair category</b>	2
<b>Notes</b>	<p>It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.</p> <p>Boilers and central heating systems should be tested and serviced by a Gas Safe registered contractor on an annual basis to ensure their safe and efficient operation.</p> <p>The central heating boiler is of an older design. Informed opinion suggests that boilers have a life expectancy between 10 and 20 years depending on the quality of the boiler and whether or not regular maintenance has been carried out. Future repair or replacement should be anticipated.</p> <p>There is evidence of possible leakage from the water tank. Further advice could be obtained from a suitably qualified contractor.</p>



## Drainage

<b>Repair category</b>	1
<b>Notes</b>	No significant defects evident.



# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	2
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	2
External decorations	-
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	1

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

# Single Survey

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and First
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

A single storey extension has been added. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

### Estimated reinstatement cost for insurance purposes

£190,000 (ONE HUNDRED AND NINETY THOUSAND POUNDS).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

### Valuation and market comments

£115,000 (ONE HUNDRED AND FIFTEEN THOUSAND POUNDS).

Demand in line with prevailing market conditions is anticipated.

The reported valuation is a snapshot in time and reflects the prevailing market conditions. The market is presently characterised by a limited supply of property and a disproportionate high demand which is resulting in premium prices being achieved in some instances. The prices being paid and the reported valuation figure may not be sustainable if market conditions change.

### Signed

Security Print Code [569916 = 5813 ]  
Electronically signed

### Report author

Kevin Masson

### Company name

DM Hall LLP

### Address

45 Bank Street, Irvine, KA12 0LL

### Date of report

2nd May 2022

# Mortgage Valuation Report



## Property Address

Address 13 ALDER GREEN, BOURTREEHILL NORTH, IRVINE, KA11 1LB  
Seller's Name Mrs Janice Kerr  
Date of Inspection 28th April 2022

## Property Details

Property Type ☒ House ☐ Bungalow ☐ Purpose built maisonette ☐ Converted maisonette  
☐ Purpose built flat ☐ Converted flat ☐ Tenement flat ☐ Flat over non-residential use  
☐ Other (specify in General Remarks)

Property Style ☐ Detached ☒ Semi detached ☐ Mid terrace ☐ End terrace  
☐ Back to back ☐ High rise block ☐ Low rise block ☐ Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? ☐ Yes ☒ No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided? ☐ Yes ☐ No  
No. of units in block

Approximate Year of Construction

## Tenure

☒ Absolute Ownership ☐ Leasehold Ground rent £  Unexpired years

## Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%) ☒ Yes ☐ No

## Garage / Parking / Outbuildings

☒ Single garage ☐ Double garage ☐ Parking space ☐ No garage / garage space / parking space  
Available on site? ☒ Yes ☐ No

Permanent outbuildings:

None.

# Mortgage Valuation Report

## Construction

Walls ☒ Brick ☐ Stone ☐ Concrete ☐ Timber frame ☐ Other (specify in General Remarks)  
Roof ☒ Tile ☐ Slate ☐ Asphalt ☐ Felt ☐ Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement? ☒ Yes ☐ No

If Yes, is this recent or progressive? ☐ Yes ☒ No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? ☐ Yes ☒ No

If Yes to any of the above, provide details in General Remarks.

## Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage ☒ Mains ☐ Private ☐ None Water ☒ Mains ☐ Private ☐ None  
Electricity ☒ Mains ☐ Private ☐ None Gas ☒ Mains ☐ Private ☐ None  
Central Heating ☒ Yes ☐ Partial ☐ None

Brief description of Central Heating:

Gas fired system to radiators.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

☐ Rights of way ☐ Shared drives / access ☐ Garage or other amenities on separate site ☐ Shared service connections  
☐ Ill-defined boundaries ☐ Agricultural land included with property ☐ Other (specify in General Remarks)

## Location

☐ Residential suburb ☒ Residential within town / city ☐ Mixed residential / commercial ☐ Mainly commercial  
☐ Commuter village ☐ Remote village ☐ Isolated rural property ☐ Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered? ☒ Yes ☐ No

If Yes provide details in General Remarks.

## Roads

☐ Made up road ☐ Unmade road ☐ Partly completed new road ☐ Pedestrian access only ☒ Adopted ☐ Unadopted

# Mortgage Valuation Report

## General Remarks

In general, the property was found to be in fair order although in need of a degree of upgrading and modernisation together with a degree of maintenance repair.

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

A single storey extension has been added. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

## Essential Repairs

None apparent.

Estimated cost of essential repairs £

Retention recommended? ☐ Yes ☒ No

Amount £

# Mortgage Valuation Report

## Comment on Mortgageability

The subjects should form suitable security for normal mortgage lending subject to individual lenders guidelines and criteria.

The reported valuation is a snapshot in time and reflects the prevailing market conditions. The market is presently characterised by a limited supply of property and a disproportionate high demand which is resulting in premium prices being achieved in some instances. The prices being paid and the reported valuation figure may not be sustainable if market conditions change.

## Valuations

Market value in present condition	£ 115,000
Market value on completion of essential repairs	£ --
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 190,000
Is a reinspection necessary?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No

## Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis?	£ --
Is the property in an area where there is a steady demand for rented accommodation of this type?	<input type="checkbox"/> Yes <input type="checkbox"/> No

## Declaration

Signed	Security Print Code [569916 = 5813 ] Electronically signed by:-
Surveyor's name	Kevin Masson
Professional qualifications	BSc (Hons) MRICS
Company name	DM Hall LLP
Address	45 Bank Street, Irvine, KA12 0LL
Telephone	01294 311070
Fax	01294 311077
Report date	2nd May 2022





# PROPERTY QUESTIONNAIRE



**DM HALL**  
CHARTERED SURVEYORS



# Property Questionnaire

<b>Property address</b>	13 ALDER GREEN, BOURTREEHILL NORTH, IRVINE, KA11 1LB
<b>Seller(s)</b>	Janice kerr
<b>Completion date of property questionnaire</b>	28/04/2022

# Property Questionnaire

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property? 24 years	
2.	Council tax	
	Which Council Tax band is your property in? (Please circle) A <b>B</b> C    D    E    F    G    H	
3.	Parking	
	<p>What are the arrangements for parking at your property?</p> <p>(Please tick all that apply)</p> <ul style="list-style-type: none"><li>• Garage <input checked="" type="checkbox"/></li><li>• Allocated parking space <input type="checkbox"/></li><li>• Driveway <input checked="" type="checkbox"/></li><li>• Shared parking <input type="checkbox"/></li><li>• On street <input type="checkbox"/></li><li>• Resident permit <input type="checkbox"/></li><li>• Metered parking <input type="checkbox"/></li><li>• Other (please specify): <input type="text"/></li></ul>	
4.	Conservation area	
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<del>Yes / No /</del> <del>Don't know</del>

# Property Questionnaire

5.	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	<del>Yes</del> / No
6.	<b>Alterations/additions/extensions</b>	
a.	<p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p><u>If you have answered yes</u>, please describe below the changes which you have made:</p>	<del>Yes</del> / No
	<p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p>	<del>Yes</del> / No
b.	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	<del>Yes</del> / No
	(i) Were the replacements the same shape and type as the ones you replaced?	<del>Yes</del> / No
	(ii) Did this work involve any changes to the window or door openings?	<del>Yes</del> / No
	<p>(iii) Please describe the changes made to the windows, doors or patio doors (with approximate dates when the work was completed):</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>	

# Property Questionnaire

<b>7.</b>	<b>Central heating</b>	
<b>a.</b>	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes / partial</u> - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p>Gas central heating</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	<b>Yes / <del>No</del> / <del>Partial</del></b>
<b>b.</b>	When was your central heating system or partial central heating system installed?	New boiler 11 years ago
<b>c.</b>	<p>Do you have a maintenance contract for the central heating system?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</p> <p>Heat plus</p>	<b>Yes / <del>No</del></b>
<b>d.</b>	When was your maintenance agreement last renewed? (Please provide the month and year).	Yearly
<b>8.</b>	<b>Energy Performance Certificate</b>	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<b>Yes / <del>No</del></b>
<b>9.</b>	<b>Issues that may have affected your property</b>	
<b>a.</b>	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>	<p><del>Yes</del> / No</p> <p><del>Yes</del> / <del>No</del></p>
<b>b.</b>	<p>Are you aware of the existence of asbestos in your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	<del>Yes</del> / No

# Property Questionnaire

<b>10.</b>	<b>Services</b>																									
<b>a.</b>	<p>Please tick which services are connected to your property and give details of the supplier:</p> <table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas / liquid petroleum gas</td> <td>✓</td> <td>Scottish gas</td> </tr> <tr> <td>Water mains / private water supply</td> <td>✓</td> <td>Scottish water</td> </tr> <tr> <td>Electricity</td> <td>✓</td> <td>Scottish power</td> </tr> <tr> <td>Mains drainage</td> <td>✓</td> <td>Council</td> </tr> <tr> <td>Telephone</td> <td>✓</td> <td>BT</td> </tr> <tr> <td>Cable TV / satellite</td> <td>✓</td> <td>Sky tv</td> </tr> <tr> <td>Broadband</td> <td>✓</td> <td>Talk talk</td> </tr> </tbody> </table>		Services	Connected	Supplier	Gas / liquid petroleum gas	✓	Scottish gas	Water mains / private water supply	✓	Scottish water	Electricity	✓	Scottish power	Mains drainage	✓	Council	Telephone	✓	BT	Cable TV / satellite	✓	Sky tv	Broadband	✓	Talk talk
Services	Connected	Supplier																								
Gas / liquid petroleum gas	✓	Scottish gas																								
Water mains / private water supply	✓	Scottish water																								
Electricity	✓	Scottish power																								
Mains drainage	✓	Council																								
Telephone	✓	BT																								
Cable TV / satellite	✓	Sky tv																								
Broadband	✓	Talk talk																								
<b>b.</b>	<p>Is there a septic tank system at your property?</p> <p><u>If you have answered yes</u>, please answer the two questions below:</p>	<b><del>Yes</del> / No</b>																								
<b>c.</b>	(i) Do you have appropriate consents for the discharge from your septic tank?	<b><del>Yes</del> / <del>No</del> / <del>Don't know</del></b>																								
<b>d.</b>	<p>(ii) Do you have a maintenance contract for your septic tank?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</p>	<b><del>Yes</del> / <del>No</del></b>																								

# Property Questionnaire

11.	<b>Responsibilities for Shared or Common Areas</b>	
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes, please give details:</u></p>	<p><del>Yes</del> / No / <del>Don't Know</del></p>
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p>	<p><del>Yes</del> / No / <del>Not applicable</del></p>
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	<p><del>Yes</del> / No</p>
d.	<p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	<p><del>Yes</del> / No</p>
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	<p><del>Yes</del> / No</p>
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>	<p><del>Yes</del> / No</p>
12.	<b>Charges associated with your property</b>	
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p>	<p><del>Yes</del> / No</p>



# Property Questionnaire

b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p><del>Yes</del> / No / <del>Don't Know</del></p> <p><del>Yes</del> / No / <del>Don't Know</del></p>
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p>	<del>Yes</del> / No
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p>If you have answered yes, please give details:</p>	<del>Yes</del> / No
c.	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<del>Yes</del> / No

# Property Questionnaire

<b>14.</b>	<b>Guarantees</b>						
<b>a.</b>	<b>Are there any guarantees or warranties for any of the following:</b>						
(i)	Electrical work	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(ii)	Roofing	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(iv)	NHBC	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
<b>b.</b>	<b>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</b>						
<b>c.</b>	<b>Are there any outstanding claims under any of the guarantees listed above?</b> <b><u>If you have answered yes, please give details:</u></b>						<b>Yes / No</b>
<b>15.</b>	<b>Boundaries</b>						
	<b>So far as you are aware, has any boundary of your property been moved in the last 10 years?</b> <b><u>If you have answered yes, please give details:</u></b>						<b>Yes / No / Don't know</b>

# Property Questionnaire

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	<del>Yes</del> / No / <del>Don't know</del>
b.	that affects your property in some other way?	<del>Yes</del> / No / <del>Don't know</del>
c.	that requires you to do any maintenance, repairs or improvements to your property?	<del>Yes</del> / No / <del>Don't know</del>
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): \_\_\_\_\_  
\_\_\_\_\_

Date: \_\_\_\_\_





# DM Hall Offices

Aberdeen

01224 594172

Galashiels

01896 752009

Livingston

01506 490404

Ayr

01292 286974

Glasgow (North)

0141 332 8615

Musselburgh

0131 665 6782

Cumbernauld

01236 618900

Glasgow (South)

0141 636 4141

Oban

01631 564225

Cupar

01334 844826

Hamilton

01698 284939

Paisley

0141 887 7700

Dumfries

01387 254318

Inverness

01463 241077

Perth

01738 562100

Dundee

01382 873100

Inverurie

01467 624393

Peterhead

01779 470220

Dunfermline

01383 621262

Irvine

01294 311070

Stirling

01786 475785

Edinburgh

0131 477 6000

Kirkcaldy

01592 598200

Elgin

01343 548501

Falkirk

01324 628321

[DMHALL.CO.UK](http://DMHALL.CO.UK)

