### survey report on:

Property address	52 Inchgarvie Avenue, Burntisland, KY3 0BU
Customer	Mr & Mrs Barr
	,
Customer address	
Prepared by	DHKK Chartered Surveyors
Date of inspection	25th July 2023



### **PART 1 - GENERAL**

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

<sup>&</sup>lt;sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

#### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
  or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

### 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

#### 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

<sup>&</sup>lt;sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

they assign the same to any other party in writing.

#### 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

### 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

### 1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

### PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

#### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

#### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

### 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	Detached townhouse with integral double garage.
Accommodation	Ground Floor - Entrance Hall, Bedroom/Study and Shower Room.  First Floor - Landing, WC Compartment, Lounge, Family Room/Bedroom with Balcony, Kitchen with Dining Area and Utility Room.  Top Floor - Landing, Principal Bedroom with Walk in Wardrobe and Ensuite Shower Room, Guest Bedroom with Ensuite Shower Room, Family Bathroom and Two Further Bedrooms.
Gross internal floor area (m²)	210 approximately.
Neighbourhood and location	The property is situated within a modern private residential estate originally constructed by Avant Homes and made up with a variety of property types. Adequate amenities are available within Burntisland, including a railway station.
Age	Built circa. 2014.
Weather	Dry and overcast.
Chimney stacks	Not applicable.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.  Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.  If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

Roofing including roof space	The roof is pitched and clad with tiles. The verges are formed in uPVC tiles. The roof design incorporates valley guttering. There is a Dormer projection to front with uPVC shiplap panelling below a pitched and tiled roof.  Access to roof space is from a ceiling hatch over the landing. The roof frame is of timber truss construction overlaid with a breathable membrane sarking. Thick insulation and partial flooring has been laid over ceilings.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	Gutters and downpipes are formed in uPVC.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	Walls are of structural timber frame inner leaf with a block render and synthetic stone outer leaf.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Windows are of uPVC double glazed casement type. Entrance doors are of uPVC composite part glazed type. There are French doors providing access to a balcony at the family room/bedroom at first floor level. There is a three section Bi-folding door at the kitchen/dining room. Facia boards appear to be formed in uPVC roof line.
External decorations	Visually inspected.
	Metalwork is painted.
Conservatories / porches	Not applicable.
Communal areas	Not applicable.
Garages and permanent outbuildings	Visually inspected.
	There is a large integral garage with a one piece double size vehicular up & over access door and a pass door to side. There appears to be space to park 4 cars.

Outside areas and boundaries	Visually inspected.
	There are garden ground to front and rear. There are monoblock parking area in front of the garage. The rear garden is terraced. Boundaries are generally formed in block walls, including retaining walls and timber fencing.
Ceilings	Visually inspected from floor level.
	Ceilings are of plasterboard having a painted finish.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Walls are of timber stud with a plasterboard finish.
Floors including sub floors	The flooring throughout are of suspended timber joists overlaid with timber boards.
	No sub-floor hatch was accessible.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Doors are of hardwood flush type. Kitchen and utility storage is provided by a range of fitted units. There is a staircase at ground floor level providing access to the upper floor. This is formed in timber treads and risers with a handrail. Upper staircases are formed in timber treads and risers with a balustrade and bannister.
Chimney breasts and fireplaces	Not applicable.
Internal decorations	Visually inspected.
	Walls are generally wallpapered, painted or tiled.
Cellars	Not applicable.
Electricity	Accessible parts of the wiring were visually inspected without
	removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains supply. The meter is located within an external box on the garage. The circuit breakers are located within the garage. There is an electric car charging point.

#### Gas

Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.

Mains supply. The meter is located within an external box on the garage.

### Water, plumbing, bathroom fittings

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

No tests whatsoever were carried out to the system or appliances.

Mains supply. The stopcock is located within the garage.

Sanitary Ware - The ground floor shower room comprises a concealed flush WC, mini pedestal wash hand basin and shower enclosure with twinhead mixer shower.

The WC suite comprises a concealed flush WC and mini pedestal wash hand basin.

The family bathroom comprises a concealed flush WC, wash hand basin on vanity unit and bath with twinhead mixer shower.

The principle bedroom ensuite shower comprises a concealed flush WC, mini pedestal wash hand basin and shower enclosure with twinhead mixer shower.

The guest bedroom ensuite shower room comprises a concealed flush WC, mini pedestal wash hand basin and shower enclosure with twinhead mixer shower.

### Heating and hot water

Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.

No tests whatsoever were carried out to the system or appliances.

There is a Potterton Promax gas fired boiler located in the utility room. There is a heat store (large hot water storage tank) located within the utility room cupboard. These supply steel panel radiators, towel radiators and also provide domestic hot water.

#### **Drainage**

Drainage covers etc were not lifted.

Neither drains nor drainage systems were tested.

Drainage is to the public sewer.

#### Fire, smoke and burglar alarms

#### Visually inspected.

No tests whatsoever were carried out to the system or appliances.

Smoke detectors and alarm system are noted.

Fire Safety Legislation effective from February 2022 requires a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat detecting alarm must be installed in every kitchen area and all smoke and heat alarms must be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance, e.g. central heating boiler, open fire, wood-burning stove etc, a carbon monoxide detector is also required. The purchaser(s) should appraise themselves of the requirements of this legislation and engage with appropriate accredited contractors to ensure compliance.

### Any additional limits to inspection

#### For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.


If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

The property was occupied, furnished and floors were covered. Cupboards had stored items present. Only random windows and doors were tested. The French doors at first floor level were not tested due to stored items. A high number of storage items were present in the garage. Our inspection of the roof space was restricted by insulation, partial flooring and high number of stored items. Only readily accessible areas were inspected.

We did not inspect the property for the purpose of identifying invasive plants. Invasive plant species are ones which typically cause ecological or economic harm in a new environment where they are not native. In some instances, invasive plants can also cause damage to built structures and may render property unsuitable for mortgage lending. While not an exhaustive list, invasive plant species include Japanese Knotweed, Giant Hogweed and Himalayan Balsam. Our valuation is made on the basis that invasive plant species are not present and note that identification is best carried out by a specialist contractor. Commonly invasive plant species require eradication by licensed contractors and the cost of eradication works may prove significant. Where we are made aware of invasive plant species being present at a property, we reserve the right to revise our assessment of Market Value.

### Sectional Diagram showing elements of a typical house

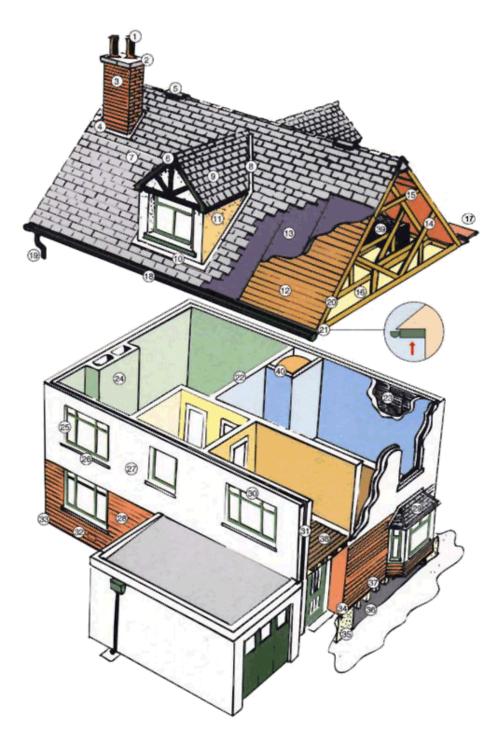

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2 Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10) Dormer flashing
- 11) Dormer cheeks
- 12) Sarking
- (13) Roof felt
- (14) Trusses
- (15) Collar
- 16) Insulation
- (17) Parapet gutter
- 18) Eaves guttering
- Rainwater downpipe
- (20) Verge boards /skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- (24) Chimney breast
- 25) Window pointing
- 6) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29 Bay window projection
- 30 Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- (36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40 Hot water tank

### 2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	There was no obvious evidence of recent or significant structural movement within the limitations of our inspection.

Dampness, rot and infestation	
Repair category	1
Notes	Damp meter readings were taken where considered appropriate within the property and moisture levels were found to be within an acceptable range.

Chimney stacks	
Repair category	-
Notes	Not applicable.

Roofing including roof space	
Repair category	1
Notes	No significant defects were noted at the time of inspection. Nevertheless, roofing contractors recommend that roof coverings are inspected regularly in order to ensure they remain watertight.

Rainwater fittings	
Repair category	1
Notes	Within the limitations of our inspection rainwater goods were seen to be free from significant defect.
	We would highlight that it was not raining at the time of our inspection and we

Rainwater fittings	
Repair category	1
Notes	would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect.

Main walls	
Repair category	1
Notes	Within the limitations of our inspection, no significant defects were noted, however normal levels of maintenance are recommended.

Windows, external doors and joinery	
Repair category	1
Notes	There is some wear to entrance door threshold seals. There is a missing trickle vent internal screen at a front upper bedroom.
	Double glazed units have an unpredictable lifespan and failure will only become apparent in certain weather conditions.

External decorations	
Repair category	1
Notes	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	-
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Outside areas and boundaries	
Repair category	1
Notes	Boundary walls and fences should be regularly checked and maintained as necessary.
	The upper garden area terrace has limited edge protection to prevent a fall.

Ceilings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Internal walls	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Floors including sub-floors	
Repair category	1
Notes	There is some creaking sections.  Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Internal joinery and kitchen fittings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Chimney breasts and fireplaces	
Repair category	-
Notes	Not applicable.

Internal decorations	
Repair category	1
Notes	Decoration is of a fresh standard.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	1
Notes	The Institute of Electrical Engineers recommends that inspections and testings are undertaken at least every ten years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IEE regulations.

Gas	
Repair category	1
Notes	In the interest of safety and in light of recent regulations it would be prudent to have all gas appliances checked annually by a Gas Safe registered contractor.

► Water, plumbing and bathroom fittings				
Repair category	1			
Notes	The cold water rising main was not inspectable.  Sanitary fittings appear serviceable however surround seals/tiling/finishes should be checked and maintained watertight. We were unable to view concealed areas below sanitary fittings and cannot confirm they are free from damp or other defects.			

Heating and hot water			
Repair category	1		
Notes	It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements.		

Drainage	
Repair category	1
Notes	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

### **Category 3**

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

### Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

### Category 1

No immediate action or repair is needed.

#### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

#### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

### 3. Accessibility information

### Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

### 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

It is assumed the remainder of the 10 year Builder Warranty (NHBC) will be available for transfer.

There is a factoring charge for mutual areas within the development and this should be verified.

#### Estimated reinstatement cost for insurance purposes

We are of the opinion that the current re-instatement value of the property with due allowance for demolition, site clearance and professional fees would be fairly stated in the region of £600,000 (SIX HUNDRED THOUSAND POUNDS). We recommend this be reviewed annually or upon any physical alterations to the property.

#### Valuation and market comments

Taking all points into consideration, we are of the opinion that the subjects have a market value of £440,000 (FOUR HUNDRED AND FORTY THOUSAND POUNDS).

Signed	Security Print Code [515276 = 6758 ] Electronically signed				
Report author	Richard R Blanski				
Company name	DHKK Chartered Surveyors				
Address	Office 12, Unit 1 Waverley Road, Mitchelston, Kirkcaldy, KY1 3NH				
Date of report	28th July 2023				



Property Address					
Address Seller's Name Date of Inspection	52 Inchgarvie Avenue, Burntisland, KY3 0BU Mr & Mrs Barr 25th July 2023				
Property Details					
Property Type	X House       Bungalow       Purpose built maisonette       Converted maisonette         Purpose built flat       Converted flat       Tenement flat       Flat over non-residential use         Other (specify in General Remarks)				
Property Style	X       Detached       Semi detached       Mid terrace       End terrace         Back to back       High rise block       Low rise block       Other (specify in General Remarks)				
Does the surveyor be e.g. local authority, m	elieve that the property was built for the public sector, Yes X No illitary, police?				
Flats/Maisonettes onl	y Floor(s) on which located No. of floors in block Lift provided? Yes No. of units in block				
Approximate Year of					
Tenure					
X Absolute Ownership	Leasehold Ground rent £ Unexpired years				
Accommodation					
Number of Rooms	2 Living room(s) 5 Bedroom(s) 1 Kitchen(s) 4 Bathroom(s) 5 WC(s) 1 Other (Specify in General remarks)				
Gross Floor Area (exc	cluding garages and outbuildings) 210 m² (Internal) 240 m² (External)				
	(greater than 40%) X Yes No				
Garage / Parking /	Outbuildings				
Single garage Available on site?	X       Double garage       Parking space       No garage / garage space / parking space         X       Yes       No				
Permanent outbuildin	gs:				
None.					

Construction								
Walls	Brick	Stone	Concrete	X Timber frame	Other (specify in General Remarks)			
Roof	X Tile	Slate	Asphalt	Felt	_	Other (specify in General Remarks)		
Special Risks								
Has the property s	uffered struc	tural movement	?			Yes	X No	
If Yes, is this recer	nt or progress	sive?				Yes	No	
Is there evidence, immediate vicinity?		ason to anticipa	te subsidence,	heave, landslip o	r flood in the	Yes	X No	
If Yes to any of the	above, prov	vide details in Ge	eneral Remark	S.				
Service Connect	tion							
Based on visual insof the supply in Ge			s appear to be	non-mains, please	e comment or	n the type ar	nd location	
Drainage	X Mains	Private	None	Water	X Mains	Private	None	
Electricity	X Mains	Private	None	Gas	X Mains	Private	None	
Central Heating	X Yes	Partial	None					
Gas fired boiler s								
Site								
Apparent legal issu	ues to be ver	ified by the conv	veyancer. Plea	se provide a brief	description ir	n General Re	emarks.	
Rights of way	Shared driv	ves / access	Garage or other	amenities on separate	site Share	ed service conn	ections	
Ill-defined boundarie	es	Agricultura	al land included wit	h property	Other	(specify in Ge	neral Remarks)	
Location								
Residential suburb	Re	sidential within town	/ city Mixe	d residential / commer	cial Mainl	y commercial		
X Commuter village	Re	mote village	Isola	ted rural property	Other	(specify in Ge	neral Remarks)	
Planning Issues								
Has the property b	een extende	d / converted / a	altered?	es X No				
If Yes provide deta	ils in Genera	al Remarks.						
Roads								
X Made up road	Unmade roa	d Partly co	mpleted new road	Pedestrian ad	ccess only	Adopted	Unadopted	

General Remarks
In addition to above accommodation, the property also has a utility room.
The property is situated within a modern private residential estate originally constructed by Avant Homes and made up with a variety of property types. Adequate amenities are available within Burntisland, including a railway station.
The property was found to be in a condition generally commensurate with its age and type of construction.
It is assumed the remainder of the 10 year Builder Warranty (NHBC) will be available for transfer.
There is a factoring charge for mutual areas within the development and this should be verified.
The property was occupied, furnished and floors were covered. Cupboards had stored items present. Only random windows and doors were tested. The French doors at first floor level were not tested due to stored items. A high number of storage items were present in the garage. Our inspection of the roof space was restricted by insulation, partial flooring and high number of stored items. Only readily accessible areas were inspected.
Forestial Beneiro
Essential Repairs
None apparent.
Estimated cost of essential repairs £ Retention recommended?Yes X No Amount £

Comment on Mortgagea	bility		
The property forms suitab mortgage provider.	le security for mortgage purposes subject to the specific lending criteria o	f any	
Valuations			
Market value in present condition  Market value on completion of essential repairs  Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) Is a reinspection necessary?  Buy To Let Cases			
What is the reasonable rangementh Short Assured Tenal	ge of monthly rental income for the property assuming a letting on a 6	£	
	here there is a steady demand for rented accommodation of this type?	Yes No	
Declaration			
Signed Surveyor's name Professional qualifications Company name Address Telephone	Security Print Code [515276 = 6758] Electronically signed by:- Richard R Blanski DipSurv FRICS DHKK Chartered Surveyors Office 12, Unit 1 Waverley Road, Mitchelston, Kirkcaldy, KY1 3NH 01592 806666		
Fax Report date	28th July 2023		

### **Energy Performance Certificate (EPC)**

**Dwellings** 

### **Scotland**

#### 52 INCHGARVIE AVENUE, BURNTISLAND, KY3 0BU

Dwelling type:Detached houseDate of assessment:25 July 2023Date of certificate:27 July 2023Total floor area:210 m²

Primary Energy Indicator: 141 kWh/m²/year

**Reference number:** 8017-8523-0000-0185-3226 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

**Main heating and fuel:** Boiler and radiators, mains


gas

#### You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£8,049	See your recommendations
Over 3 years you could save*	£	report for more information

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

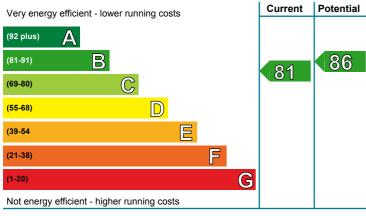


### **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band B (81)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

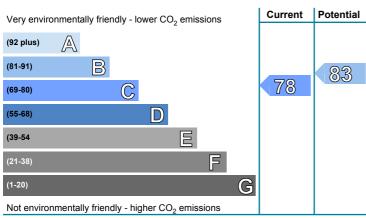

### **Environmental Impact (CO<sub>2</sub>) Rating**

This graph shows the effect of your home on the environment in terms of carbon dioxide  $(CO_2)$  emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (78)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

### Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Solar photovoltaic (PV) panels	£3,500 - £5,500	£1860.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

### Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed)	****	****
Roof	Pitched, 270 mm loft insulation	****	<b>★★★★☆</b>
Floor	Suspended, insulated (assumed) To unheated space, insulated (assumed)	_ _	_ _
Windows	Fully double glazed	****	<b>★★★</b> ☆
Main heating	Boiler and radiators, mains gas	****	<b>★★★</b> ☆
Main heating controls	Programmer, room thermostat and TRVs	****	<b>★★★</b> ☆
Secondary heating	None	_	_
Hot water	From main system	****	<b>★★★</b> ☆
Lighting	Low energy lighting in 91% of fixed outlets	****	****

### The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

### The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 25 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.2 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.9 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

### Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£6,360 over 3 years	£6,360 over 3 years	
Hot water	£915 over 3 years	£915 over 3 years	You could
Lighting	£774 over 3 years	£774 over 3 years	save £
Totals	£8,049	£8,049	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

### **Recommendations for improvement**

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures		lu disetiva eset	Typical saving	Rating after improvement	
		Indicative cost	per year	Energy	Environment
1	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£620	B 86	B 83

### Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

### About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

### Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

### Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	17,156	N/A	N/A	N/A
Water heating (kWh per year)	2,548			

### **About this document**

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Richard Blanski
Assessor membership number: EES/014228
Company name/trading name: DHKK Limited

Address: 54 Corstorphine Road

Edinburgh EH12 6JQ

Phone number: 0131 313 0444
Email address: survey@dhkk.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

### Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



Property Address	52 Inchgarvie Avenue Burntisland Fife KY3 0BU
Seller(s)	Mr Richard Barr & Mrs Jodie Barr
Completion date of Property Questionnaire	25/07/2023

### **Note for sellers**

- Please complete this form carefully. It is important your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell you solicitor or estate agent immediately.

### Information to be given to prospective buyer(s)

1.	Length of Ownership						
	How long have you owned t	he property?	8 years.	7 months.			
2.	Council Tax						
	Which Council Tax band is y	our property in?					
	□A □B □0	D 🗆 D	□ E	□F	⊠G		
3.	Parking						
	What are the arrangements	for parking at yo	ur property?	>			
	(Please tick all that apply)						
	Garage						
	Allocated parking space						
	Driveway						
	On street						
	Resident Permit						
	Metered parking						
	Shared parking						
	Other (please specify)						

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	No
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations/Additions/Extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example provision of an extra bath/shower room, toilet or bedroom)?  If you have answered yes, please describe below the changes which you have made:	No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?  If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them.	N/A
b.	Have you had replacement windows, doors, patio doors or double-glazing installed in your property? If you have answered yes, please answer the three questions below:	No
	(i) Were the replacements the same shape and type as the ones you replaced?	N/A
	(ii) Did this work involve any changes to the window or door openings?	N/A
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):	

7.	Central heating	
	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	Yes
	If you have answered yes or partial – what kind of central heating is there?	
	gas fired	
	(examples: gas-fired, solid fuel, electric storage heating, gas-warm air).	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed?	
	2014	
	(ii) Do you have a maintenance contract for the central heating system?	Yes
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
	Corgi	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
	November 2022	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate, which is less than 10 years old?	No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	N/A

b.	Are you aware of the existence of asbest	perty?	No	
	If you have answered yes, please give de	etails:		
10.	Services			
a.	Please tick which services are connected supplier:	d to your prope	rty and give details of the	
	Services	Connected	Supplier	
	Gas or liquid petroleum gas	$\boxtimes$	Octopus Energy	
	Water mains or private water supply			
	Electricity	$\boxtimes$	Octopus Energy	
	Mains drainage			
	Telephone	$\boxtimes$	Sky	
	Cable TV or satellite	$\boxtimes$	Sky	
	Broadband		Sky	
b.	Is there a septic tank system at your p	property?		No
	If you have answered yes, please answe	er the two ques	tions below:	
	(i) Do you have appropriate consents for	N/A		
	(ii) Do you have a maintenance contract	N/A		
	If you have answered yes, please give de have a maintenance contract:			

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	Yes
	If you have answered yes, please give details:	
	Common grounds maintenance with Hacking & Paterson factoring	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	No
	If you have answered yes, please give details:	
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	No
	If you have answered yes, please give details:	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	No
	If you have answered yes, please give details:	

f.	As far as you are aware, is there a public right of way across any part of your property (public right of way is a way over privately-owned)?	No
	If you have answered yes, please give details:	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	Yes
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	
	Hacking & Paterson 103 East London Street	
	Edinburgh EH7 4BF	
b.	Is there a common buildings insurance policy?	No
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	N/A
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	

13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?  If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	No
b.	As far as you were aware, has any preventative work for dry rot, wet rot, or damp, ever been carried out to your property?  If you have answered yes, please give details:	No
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?  If you have answered yes these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	N/A

14.	Guarante	es	
a.	Are there	any guarantees or warranties for any of the following:	
	(i)	Electrical work	No
	(ii)	Roofing	No
	(iii)	Central heating	No
	(iv)	National House Building Council (NHBC)	Yes
	(v)	Damp course	No
	(vi)	Any other work or installations (for example, cavity wall insulation, underpinning, indemnity policy)	No
b.		e answered yes or 'with title deeds', please give details of the work or ns to which the guarantee(s) relate(s):	
c.		any outstanding claims under any of the guarantees listed above?  e answered yes, please give details:	No
15.	Boundari	es	
	last 10 ye	you are aware, has any boundary of your property been moved in the ars?  e answered yes, please give details:	No

16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes
b.	that affects your property in some other way?	No
C.	that requires you to do any maintenance, repairs or improvements to your property?	No
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)
I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.
Signature(s):
Date: