HOME REPORT



50 MOAT VIEW ROSLIN EH25 9NZ







ENERGY PERFORMANCE CERTIFICATE



Energy Performance Certificate (EPC)

Dwellings

Scotland

50 MOAT VIEW, ROSLIN, EH25 9NZ

Dwelling type: Semi-detached house

Date of assessment:26 June 2024Date of certificate:27 June 2024

Total floor area: 82 m²

Primary Energy Indicator: 226 kWh/m²/year

Reference number: 0160-2556-7260-2824-2215 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,870	See your recommendations
Over 3 years you could save*	£420	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

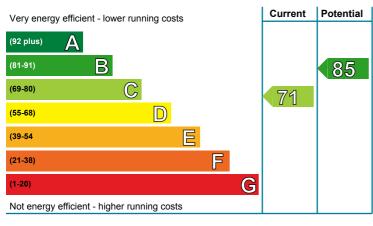


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (71)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

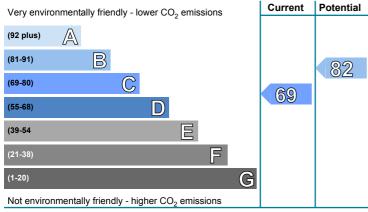

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (69)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (solid floor)	£4,000 - £6,000	£258.00
2 Solar water heating	£4,000 - £6,000	£162.00
3 Solar photovoltaic (PV) panels	£3,500 - £5,500	£1431.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, filled cavity Cavity wall, as built, no insulation (assumed)	**** ***	**** ***
Roof	Pitched, 250 mm loft insulation Flat, limited insulation (assumed)	**** ***	**** ****
Floor	Solid, no insulation (assumed)	_	_
Windows	Fully double glazed	★★★★ ☆	★★★ ☆
Main heating	Boiler and radiators, mains gas	★★★★ ☆	★★★ ☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★ ☆	★★★ ☆
Secondary heating	None	_	_
Hot water	From main system	****	****
Lighting	Low energy lighting in 92% of fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 40 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.3 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£3,042 over 3 years	£2,784 over 3 years	
Hot water	£498 over 3 years	£336 over 3 years	You could
Lighting	£330 over 3 years	£330 over 3 years	save £420
Total	s £3,870	£3,450	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures		Indicative cost	Typical saving	Rating after improvement		
Recommende	a measures	Indicative cost	per year	Energy	Environment	
1 Floor insul	ation (solid floor)	£4,000 - £6,000	£86	C 73	C 71	
2 Solar wate	r heating	£4,000 - £6,000	£54	C 74	C 73	
3 Solar phot	ovoltaic panels, 2.5 kWp	£3,500 - £5,500	£477	B 85	B 82	

Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

2 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

3 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	10,488	N/A	(326)	N/A
Water heating (kWh per year)	2,010			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Charles Barrett

Assessor membership number: EES/017864

Company name/trading name: D M Hall Chartered Surveyors LLP

Address: 17 Corstorphine Road

Edinburgh EH12 6DD

Phone number: 01314776000

Email address: charles.barrett@dmhall.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



SINGLE SURVEY



survey report on:

Property address	50 MOAT VIEW, ROSLIN, EH25 9NZ
Customer	Ms Audrey Gunning
Customer address	50 Moat View, Roslin, EH25 9NZ
Prepared by	DM Hall LLP
Date of inspection	26th June 2024



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
 or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The property comprises a two storey semi-detached house with single storey front porch extension.
Accommodation	GROUND FLOOR:- Entrance Porch, Open Plan Living Room and Dining Room, Kitchen.
	FIRST FLOOR:- Three Bedrooms and Shower Room.
Gross internal floor area (m²)	82m2 approximately.
Neighbourhood and location	The property is situated within an established, residential location within the village of Roslin. Surrounding properties are of a similar age, type and style of construction. Within a reasonable distance, a range of facilities and amenities can be found.
Age	Built circa 1970.
Weather	Overcast but dry with sunny spells.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate.
	The chimney is of pointed brick with metal flashings.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe

And reasonable to do so. The roof is pitched and clad in concrete tiles with a tiled ridge and cement pointed verge. Access to the roof space was gained through a ceiling hatch to the first floor hallway. The roof frame is formed in a cut imber russ overlaid in insulated sarking felt. Insulation between and over joists to a significant depth limited the inspection. Only a head and shoulders inspection was undertaken. Rainwater fittings Visually inspected with the aid of binoculars where appropriate. PVC rainwater goods. Visually inspected with the aid of binoculars where appropriate. PVC rainwater goods. Walls are formed in a traditional cavity brick and block construction finished externally in render. We understand cavity wall insulation has been installed. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. uPVC double glazed replacement windows and doors. Fascias are of PVC and soffits are of cement. External decorations Visually inspected. Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a flat felt coverides access to the front. Electricity is connected.		
cement pointed verge. Access to the roof space was gained through a celling hatch to the first floor hallway. The roof frame is formed in a cut timber truss overlaid in insulated sarking felt. Insulation between and over joists to a significant depth limited the inspection. Only a head and shoulders inspection was undertaken. Visually inspected with the aid of binoculars where appropriate.	Roofing including roof space	and reasonable to do so.
appropriate. PVC rainwater goods. Wisually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. Walls are formed in a traditional cavity brick and block construction finished externally in render. We understand cavity wall insulation has been installed. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. uPVC double glazed replacement windows and doors. Fascias are of PVC and soffits are of cement. External decorations Visually inspected. Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides		cement pointed verge. Access to the roof space was gained through a ceiling hatch to the first floor hallway. The roof frame is formed in a cut timber truss overlaid in insulated sarking felt. Insulation between and over joists to a significant depth limited the
appropriate. PVC rainwater goods. Wisually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. Walls are formed in a traditional cavity brick and block construction finished externally in render. We understand cavity wall insulation has been installed. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. uPVC double glazed replacement windows and doors. Fascias are of PVC and soffits are of cement. External decorations Visually inspected. Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides		
Main walls Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. Walls are formed in a traditional cavity brick and block construction finished externally in render. We understand cavity wall insulation has been installed. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. uPVC double glazed replacement windows and doors. Fascias are of PVC and soffits are of cement. External decorations Visually inspected. Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides	Rainwater fittings	
appropriate. Foundations and concealed parts were not exposed or inspected. Walls are formed in a traditional cavity brick and block construction finished externally in render. We understand cavity wall insulation has been installed. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. uPVC double glazed replacement windows and doors. Fascias are of PVC and soffits are of cement. External decorations Visually inspected. Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides		PVC rainwater goods.
inspected. Walls are formed in a traditional cavity brick and block construction finished externally in render. We understand cavity wall insulation has been installed. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. uPVC double glazed replacement windows and doors. Fascias are of PVC and soffits are of cement. External decorations Visually inspected. Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Garages and permanent outbuildings Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides	Main walls	•
finished externally in render. We understand cavity wall insulation has been installed. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. uPVC double glazed replacement windows and doors. Fascias are of PVC and soffits are of cement. External decorations Visually inspected. Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides		·
keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. uPVC double glazed replacement windows and doors. Fascias are of PVC and soffits are of cement. External decorations Visually inspected. Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides		finished externally in render. We understand cavity wall insulation
keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. uPVC double glazed replacement windows and doors. Fascias are of PVC and soffits are of cement. External decorations Visually inspected. Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides		
Doors and windows were not forced open. uPVC double glazed replacement windows and doors. Fascias are of PVC and soffits are of cement. External decorations Visually inspected. Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides	Windows, external doors and joinery	·
uPVC double glazed replacement windows and doors. Fascias are of PVC and soffits are of cement. External decorations Visually inspected. Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides		Random windows were opened and closed where possible.
Fascias are of PVC and soffits are of cement. Visually inspected. Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides		Doors and windows were not forced open.
External decorations Visually inspected. Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides		uPVC double glazed replacement windows and doors.
Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides		Fascias are of PVC and soffits are of cement.
Painted and PVC finishes. Conservatories / porches Visually inspected. To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides	External decorations	Visually inspected.
To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides		, ,
To the front of the property, is a single storey porch extension formed in masonry construction below a flat felt covering. Communal areas Not applicable. Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides	Conservatories / porches	Visually inspected.
Garages and permanent outbuildings Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides		To the front of the property, is a single storey porch extension
Garages and permanent outbuildings Visually inspected. The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides		
The property has a single car attached garage formed in brick construction below a felt roof. A metal up and over door provides	Communal areas	Not applicable.
construction below a felt roof. A metal up and over door provides	Garages and permanent outbuildings	Visually inspected.
		construction below a felt roof. A metal up and over door provides

Outside areas and boundaries	Visually inspected.
	Garden is to the front and rear with boundaries formed in timber fencing. To the side of the property is a blockwork retaining wall
	with metal fence. Off road parking is on a driveway to the front.
Ceilings	Visually inspected from floor level.
	Plasterboard throughout the property with a textured plaster finish applied in areas.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Plastered masonry and plasterboard.
Flagra including out flagra	
Floors including sub floors	Solid concrete ground floor and suspended timber first floor. There is no sub-floor to inspect and floor coverings were not moved or lifted.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The kitchen is fitted with floor and wall units.
	Internal doors and joinery are of timber.
Chimney breasts and fireplaces	Viewelly increased
Chilling breasts and meplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	There is a gas fire in the living room.
Internal decorations	Visually inspected.
	Painted, papered, wet wall panelling and timber panelling finishes
	noted.
Cellars	Net and Karlin
- Cinai S	Not applicable.
Electricity	Accessible parts of the wiring were visually inspected without
-	removing fittings. No tests whatsoever were carried out to the
	system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and
	meet modern standards. If any services are turned off, the
	surveyor will state that in the report and will not turn them on.
	Mains supply of electricity with the meter and consumer unit located in an understair cupboard.

Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply of gas. The meter is located in an understair cupboard.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Mains supply of water. Visible pipework is of PVC and copper.
	The shower room is fitted with a shower cubicle with WC and wash hand basin.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	The property is fitted with a gas fired boiler located in a bedroom cupboard. The boiler serves radiators and provides hot water on demand.
Drainage	Drainage covers etc were not lifted.
	Neither drains nor drainage systems were tested.
	Drainage we understand is to the main sewer.
Fire, smoke and burglar alarms	Visually inspected.
,	No tests whatsoever were carried out to the system or
	appliances.
	We are advised by the seller that inter-linked smoke alarms and heat detectors have been installed to comply with Scottish Government legislation, which took effect from February 2022. It is outwith the scope of this report to check the compliance or functionality of such appliances and systems, purchasers should satisfy themselves in this regard.
Any additional limits to inspection	Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

properties.

We have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation we have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring

Any additional limits to inspection

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

The report does not include an asbestos inspection. However, asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos-based products has been reported within the limitations of this inspection, and you have concerns, you should engage a qualified asbestos surveyor.

The property was occupied, fully furnished and floors were covered. Floor coverings restricted the inspection of flooring.

In accordance with Health and Safety guidelines, we have not disturbed insulation, furniture or personal effects (particularly in cupboards).

Personal effects in cupboards and fitted wardrobes were not moved and restricted the inspection.

The roof void inspection was limited by insulation concealing joists from view, stored goods and a lack of suitable access boarding. The roof void inspection was undertaken from the access hatch only.

The external inspection of the roof covering was restricted from ground level and some parts were not visible.


There is no sub-floor area to inspect.

We did not test all windows. Windows were tested at random.

Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly, with resultant damage to concealed parts of the fabric.

Where repairs are required at height, compliance with Health and Safety legislation often requires the use of scaffolding, which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report, but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

Sectional Diagram showing elements of a typical house

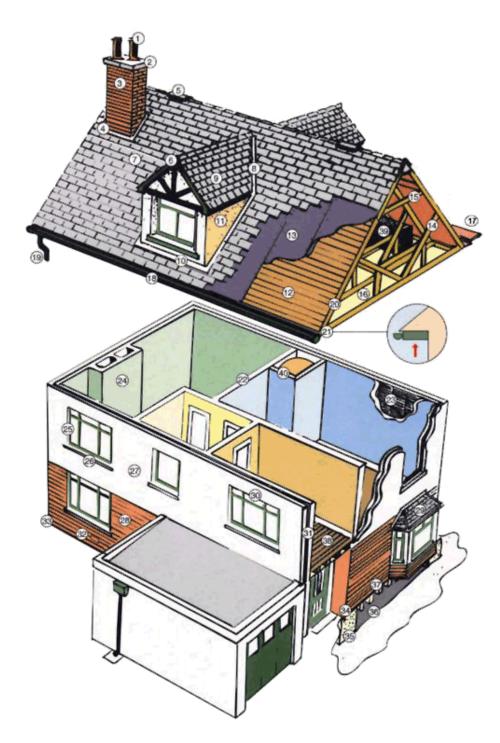

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10) Dormer flashing
- 11) Dormer cheeks
- 12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- (17) Parapet gutter
- (18) Eaves guttering
- 19) Rainwater downpipe
- (20) Verge boards /skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- 25) Window pointing
- 26) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- 31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- (39) Water tank
- 40 Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	No obvious evidence of significant movement noted within the limitations of the inspection.

Dampness, rot and infestation	
Repair category	1
Notes	There is evidence of condensation in various locations. This may be alleviated by a proper balance of heating and ventilation.

Chimney stacks	
Repair category	2
Notes	Localised areas of weathered pointing and brickwork noted to the chimney stack.

Roofing including roof space	
Repair category	2
Notes	The roof covering is original. We noted missing pointing to the verge and moss growth to the roof covering. Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair/replacement costs.

Rainwater fittings	
Repair category	2
Notes	There is evidence of water leakage indicated by staining to the external wall.
50 MOAT VIEW,	

Rainwater fittings	
Repair category	2
Notes	Rainwater fittings should be checked during rainfall to ascertain their adequacy and any required adjustments should be made.

Main walls	
Repair category	1
Notes	Localised areas of cracked and weathered render noted.

Windows, external doors and joinery	
Repair category	1
Notes	Soffits may contain asbestos in their construction. See Limitations to Inspection above.

External decorations	
Repair category	1
Notes	No significant defects evident.

Conservatories/porches	
Repair category	2
Notes	Ponding water noted on the flat roof covering of the porch. This type of roof covering can have a limited life span and can fail unexpectedly.

Communal areas	
Repair category	-
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	2
Notes	Evidence of damp penetration to roofing timbers within the garage. Roofing

Garages and permanent outbuildings	
Repair category	2
Notes	timbers of the garage have been affected by woodworm in the past. A competent specialist can advise further. Render repairs are required to the garage external wall finish. The garage is a comparatively basic structure, as such repair and maintenance works are required.

Outside areas and boundaries	
Repair category	1
Notes	No significant defects evident.

Ceilings	
Repair category	1
Notes	The textured finishes may contain asbestos based material. See information on Asbestos in the Limitations of Inspection section above.

Internal walls	
Repair category	1
Notes	No significant defects evident.

Floors including sub-floors	
Repair category	1
Notes	Noisy flooring noted in areas. It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.

Internal joinery and kitchen fittings	
Repair category	1
Notes	Glazed inserts may not be of toughened safety glass.

Chimney breasts and fireplaces	
Repair category	1
Notes	All gas fires should be tested for safety prior to use by a Gas Safe registered contractor.

Internal decorations	
Repair category	1
Notes	Timber panelling to the wall and ceilings should be treated with a fire retardant finish.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	2
Notes	The electrical installation is of a mixed age and a competent electrician can advise further.
	It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.

Gas	
Repair category	1
Notes	Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

► Water, plumbing and bathroom fittings			
Repair category	1		
Notes	Ongoing maintenance to sealant and grout around sanitary fittings is to be expected. Failure to seals and/or grout can result in dampness/decay in hidden areas.		

Heating and hot water			
Repair category	1		
Notes	It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations. Boilers and central heating systems should be tested and serviced by a Gas Safe registered contractor on an annual basis to ensure their safe and efficient operation.		

Drainage	
Repair category	1
Notes	No significant defects evident.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	2
Communal areas	-
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and First
The state of the s	
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes No X
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Alterations include a porch extension and the construction of the garage. We understand these were undertaken prior to the present seller purchasing the property over 30 years ago.

The property is situated in an area of past mining activity. A mining report should be obtained from the Coal Authority to provide information as to historic and future mining activity and whether or not the property has been the subject of any compensation claims.

Estimated reinstatement cost for insurance purposes

It should be noted, this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

It is recommended the property be insured on a reinstatement basis for a figure not less than £270,000.

Valuation and market comments

In our opinion, the current market value of the above property in present condition would be fairly stated in the sum of £260,000.

Signed	Security Print Code [482671 = 6222] Electronically signed				
Report author	Charlie Barrett				
Company name	DM Hall LLP				
Address	17 Corstorphine Road, Edinburgh, EH12 6DD				
Date of report	27th June 2024				

Mortgage Valuation Report



Property Address				
Address 50 MOAT VIEW, ROSLIN, EH25 9NZ Seller's Name Ms Audrey Gunning Date of Inspection 26th June 2024				
Property Details				
Property Type	X House Bungalow Chalet Purpose built maisonette Coach Studio Converted maisonette Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)			
Property Style	□ Detached X Semi detached ■ Mid terrace ■ End terrace □ Back to back □ High rise block □ Low rise block □ Other (specify in General Remarks)			
Does the surveyor be e.g. local authority, m	elieve that the property was built for the public sector, Yes X No nilitary, police?			
Flats/Maisonettes onl				
Approximate Year of				
Tenure				
X Absolute Ownership	Leasehold Ground rent £ Unexpired years			
Accommodation				
Number of Rooms	2 Living room(s) 3 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 0 WC(s) 1 Other (Specify in General remarks)			
Gross Floor Area (ex	cluding garages and outbuildings) 82 m² (Internal) 93 m² (External)			
Residential Element ((greater than 40%) X Yes No			
Garage / Parking /	Outbuildings			
X Single garage Available on site?	□ Double garage □ Parking space □ No garage / garage space / parking space ▼ Yes □ No			
Permanent outbuildin	igs:			
None.				

Mortgage Valuation Report

Construction							
Walls	X Brick	Stone	Concrete	Timber frame			
	Solid	X Cavity	Steel frame	X Concrete block	Other	(specify in Gen	eral Remarks)
Roof	X Tile	Slate	Asphalt	Felt		(,
	Lead	Zinc	Artificial slat		Other	(specify in Gen	eral Remarks)
						•	·
Special Risks							
Has the property	suffered struct	ural movemen	t?			Yes	X No
If Yes, is this rece	ent or progress	ive?				Yes	No
Is there evidence immediate vicinity	, history, or rea /?	ason to anticip	ate subsidence,	heave, landslip o	or flood in the	Yes	X No
If Yes to any of th	e above, provi	de details in G	General Remarks	S.			
Service Connec	ction						
		If any comics	os appoarta ha	non maine place:	n comment a	n the tune of	ad location
Based on visual in of the supply in G			s appear to be i	ion-mains, piease	e comment o	ii iiie type ai	iu iocation
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None				
Brief description of	of Central Hea	ting:					
Gas fired radiate	or system.						
Site							
Apparent legal iss	suce to be veri	find by the cor	wowancor Plan	so provide a brief	description is	n Gonoral P	omarke
Rights of way	Shared drive		=	menities on separate	_	ed service conr	
Agricultural land in			Ill-defined bounda			r (specify in Ge	
	.о.ааоа р. ор о	,				. (оросп) пт СС	
Location							
X Residential suburb	Res	idential within tow	n / city Mixed	d residential / commer	cial Main	ly commercial	
Commuter village	Ren	note village	Isolat	ed rural property	Othe	r (specify in Ge	neral Remarks)
Planning Issue	s						
Has the property	been extended	d / converted /	altered? X Y	es No			
If Yes provide det	tails in Genera	l Remarks.					
Roads							
X Made up road	Unmade road	Partly c	ompleted new road	Pedestrian a	ccess only	Adopted	Unadopted

Mortgage Valuation Report

General Remarks			
The property is within an established residential area, convenient for local facilities and amenities.			
OTHER ACCOMMODATION:- Entrance Porch.			
Alterations include a porch extension and the construction of the garage. We understand these were undertaken prior to the present seller purchasing the property over 30 years ago.			
The property is situated in an area of past mining activity. A mining report should be obtained from the Coal Authority to provide information as to historic and future mining activity and whether or not the property has been the subject of any compensation claims.			
Essential Repairs			
In our opinion no essential repairs are required for the purposes of mortgage loan security.			
Estimated cost of essential repairs £ - Retention recommended? Yes X No Amount £ -			

Mortgage Valuation Report

Comment on Mortgagea	bility		
Subject to normal lending	criteria, the property generally forms suitable security for mortgage purpo	oses.	
Valuations			
Market value in present condition Market value on completion of essential repairs Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) Is a reinspection necessary? Buy To Let Cases			
What is the reasonable range	ge of monthly rental income for the property assuming a letting on a 6	£ -	
month Short Assured Tenanus the property in an area w	ncy basis? There there is a steady demand for rented accommodation of this type?	Yes No	
Signed	Security Print Code [482671 = 6222] Electronically signed by:-		
Surveyor's name Professional qualifications	Charlie Barrett BSc (Hons) MRICS DM Hall LLP		
Company name Address Telephone	Address 17 Corstorphine Road, Edinburgh, EH12 6DD		
Fax Report date	0131 624 6609 27th June 2024		

PROPERTY QUESTIONNAIRE





IIAN
Z

MRS AUDREY GUNNING

Completion date of property questionnaire	26/06/2024	
---	------------	--

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property? 32 YEARS	
2.	Council tax	
	Which Council Tax band is your property in? (Please tick one) ☐ A ☐ B ☐ C ☑ D ☐ E ☐ F ☐ G ☐ H	
3.	Parking	
	What are the arrangements for parking at your property? (Please tick all that apply)	
	• Garage ⊠	
	Allocated parking space	
	• Driveway	
	Shared parking	
	On street	
	Resident permit	
	Metered parking	
	Other (please specify):	
4.	Conservation area	
	Is your property in a designated Conservation Area (that is an a of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	rea Yes No Don't know

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	☐ Yes ☑ No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe below the changes which you have made:	☐ Yes ☑ No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	☐ Yes ☑ No
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	⊠ Yes □ No
	(i) Were the replacements the same shape and type as the ones you replaced?	⊠ Yes □ No
	(ii) Did this work involve any changes to the window or door openings?	☐ Yes ☑ No
	(iii) Please describe the changes made to the windows doors, or patie approximate dates when the work was completed): 2009	o doors (with
Please give any guarantees which you received for this work to your soli agent.		solicitor or estate

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). If you have answered yes or partial — what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). GAS FIRED If you have answered yes, please answer the three questions below:	☐ Yes ☐ No ☐ Partial
	(i) When was your central heating system or partial central heatinstalled? 2009	ng system
	(ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract: SCOTTISH GAS	⊠ Yes □ No
	(iii) When was your maintenance agreement last renewed? (Pleas month and year). MAY 24	e provide the
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	☐ Yes ☑ No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it? If you have answered yes, is the damage the subject of any outstanding insurance claim?	☐ Yes ☑ No ☐ Yes ☐ No
b.	Are you aware of the existence of asbestos in your property? If you have answered yes, please give details:	☐ Yes ☑ No

10.	Services					
a. Pl	. Please tick which services are connected to your property and give details of the supplier:					
	Services	Connected	Supplier			
	Gas or liquid petroleum gas	GAS	SCOTTISH	GAS		
Water mains or private water supply WATER MAINS SCOTTISH V		WATER				
	Electricity	YES	SCOTTISH	POWER		
Mains drainage SCOTT		SCOTTISH	TTISH WATER			
	Telephone		ВТ			
	Cable TV or satellite					
Broadband						
b.	Is there a septic tank system a	at your property?		☐ Yes		
	If you have answered yes, please answer the two questions below: (iv) Do you have appropriate consents for the discharge from your septic tank? (v) Do you have a maintenance contract for your septic tank? If you have answered yes, please give details of the company with which you have a maintenance contract:			⊠ No		
				☐ Yes ☐ No ☐ Don't Know		
				☐ Yes ☐ No		

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	☐ Yes ☑ No ☐ Don't Know
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	☐ Yes ☑ No ☐ Not applicable
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	☐ Yes ☑ No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	☐ Yes ☑ No
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	☐ Yes ☑ No
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) If you have answered yes, please give details:	☐ Yes ☑ No
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	☐ Yes ☑ No

b.	Is there a common buildings insurance policy? If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges? Please give details of any other charges you have to pay on a regular upkeep of common areas or repair works, for example to a residents maintenance or stair fund.	Yes No Don't Know Yes No Don't Know basis for the association, or
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	☐ Yes ☑ No
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? If you have answered yes, please give details:	☐ Yes ☑ No
c.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	☐ Yes ☐ No

14.	Guarantees					
a.	Are there any guarantees or warranties for any of the following:					
		No	Yes	Don't know	With title deeds	Lost
(i)	Electrical work	\boxtimes				
(ii)	Roofing					
(iii)	Central heating					
(iv)	National House Building Council (NHBC)	\boxtimes				
(v)	Damp course	\boxtimes				
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	\boxtimes				
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):					
C.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:				☐ Yes ☑ No	
15.	Boundaries					
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:				☐ Yes ☑ No ☐ Don't know	

16.	Notices that affect your property					
	In the past three years have you ever received a notice:					
a.	advising that the owner of a neighbouring property has made a planning application?	☐ Yes ☑ No				
b.	that affects your property in some other way?	☐ Yes ☑ No				
C.	that requires you to do any maintenance, repairs or improvements to your property?	☐ Yes ☑ No				
	If you have answered yes to any of $a-c$ above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.					

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.



ABERDEEN

aberdeen_residential@dmhall.co.uk01224 594172

AYR

ayr@dmhall.co.uk 01292 286974

DUMFRIES

dumfries@dmhall.co.uk 01387 254318

DUNDEE

dundee@dmhall.co.uk 01382 873100

DUNFERMLINE

dunfermline@dmhall.co.uk 01383 621262

EDINBURGH

edinburghresidential@dmhall.co.uk 0131 624 6600

FLGIN

elgin@dmhall.co.uk 01343 548501

FALKIRK

falkirk@dmhall.co.uk 01324 628321

GALASHIELS

galashiels@dmhall.co.uk 01896 752009

GLASGOW (Residential)

glasgowresidential@dmhall.co.uk 0141 636 4141

HAMILTON

hamilton@dmhall.co.uk 01698 284939

INVERNESS

inverness@dmhall.co.uk 01463 241077

INVERURIE

inverurie@dmhall.co.uk 01467 624393

IRVINE

irvine@dmhall.co.uk 01294 311070

KIRKCALDY

kirkcaldy@dmhall.co.uk 01592 598200

LIVINGSTON

livingston@dmhall.co.uk 01506 490404

OBAN

oban-admin@dmhall. co.uk 01631 564225

PAISLEY

Enquiries are now dealt with at our Glasgow Hub.

PERTH

perth@dmhall.co.uk 01738 562100

PETERHEAD

peterhead@dmhall.co.uk 01779 470220

ST ANDREWS

standrews@dmhall.co.uk 01334 844826

STIRLING

stirling@dmhall.co.uk 01786 475785

