HOME REPORT

AVERCOAD

9 PRIVATE ROAD GOREBRIDGE EH23 4HG



ENERGY PERFORMANCE CERTIFICATE





Energy Performance Certificate (EPC)

Scotland

Dwellings

9 PRIVATE ROAD, GOREBRIDGE, EH23 4HG

Dwelling type:	Detached house
Date of assessment:	05 February 2024
Date of certificate:	09 February 2024
Total floor area:	164 m ²
Primary Energy Indicator:	475 kWh/m ² /year

Reference number: Type of assessment: Approved Organisation: Main heating and fuel:


5600-8452-0522-4101-1243 RdSAP, existing dwelling Elmhurst Boiler and radiators, mains gas


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£15,117	See your recommendations
Over 3 years you could save*	£7,758	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

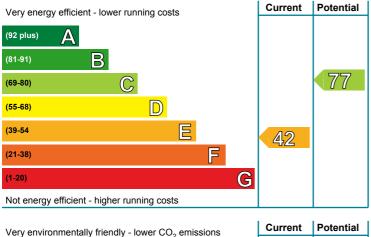

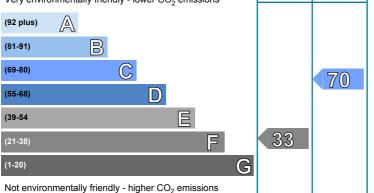

Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (42)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (33)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Room-in-roof insulation	£1,500 - £2,700	£4977.00
2 Internal or external wall insulation	£4,000 - £14,000	£1770.00
3 Floor insulation (suspended floor)	£800 - £1,200	£1011.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282. THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed) $\bigstar \bigstar \bigstar$		★★☆☆☆
Roof	Roof room(s), no insulation (assumed)	****	$\bigstar & & & & & & & & \\ \bigstar & & & & & & & & & $
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★☆☆	★★★☆☆
Main heating	Boiler and radiators, mains gas	★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★☆	★★★★☆
Secondary heating	Room heaters, mains gas	—	—
Hot water	From main system	★★★☆	★★★★☆
Lighting	Low energy lighting in 92% of fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 84 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 14 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 8.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

9 PRIVATE ROAD, GOREBRIDGE, EH23 4HG 09 February 2024 RRN: 5600-8452-0522-4101-1243

Estimated energy costs for this home **Current energy costs** Potential energy costs Potential future savings Heating £13,947 over 3 years £6,186 over 3 years Hot water £618 over 3 years £621 over 3 years You could Lighting £552 over 3 years £552 over 3 years save £7,758 £7,359 Totals £15,117 over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

De	commended measures	Indicative cost	Typical saving	Rating after improvement		
Re	commended measures	indicative cost	per year	Energy	Environment	
1	Room-in-roof insulation	£1,500 - £2,700	£1659	D 60	E 50	
2	Internal or external wall insulation	£4,000 - £14,000	£590	D 67	D 59	
3	Floor insulation (suspended floor)	£800 - £1,200	£337	C 71	D 64	
4	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£516	C 77	C 70	

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

2 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide longlasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	39,270	(1,013)	N/A	(4,479)
Water heating (kWh per year)	2,327			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Assessor membership number: Company name/trading name: Address:	Mr. Charles Barrett EES/017864 D M Hall Chartered Surveyors LLP 17 Corstorphine Road Edinburgh EH12 6DD
Phone number:	01314776000
Email address:	charles.barrett@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

9 PRIVATE ROAD, GOREBRIDGE, EH23 4HG 09 February 2024 RRN: 5600-8452-0522-4101-1243

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.





SINGLE SURVEY





survey report on:

Property address 9 PRIVATE ROAD, GOREBRIDGE, EH23 4HG

Customer Mr & Mrs Fuchs

Customer address	

Prepared by	DM Hall LLP

Date of inspection	5th February 2024
--------------------	-------------------



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.



The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

Terms and Conditions

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The property comprises a two storey detached house.
Accommodation	Ground Floor: Entrance hallway, living room, sitting room, kitchen, bedroom and shower room. First Floor: Landing, three bedrooms, bathroom and utility cupboard.

Gross internal floor area (m²)	164m2 approximately.
Neighbourhood and location	The property is situated within an established residential area
	where surrounding properties are of similar age, type and style of construction. Within a reasonable distance a range of facilities and amenities can be found.

Age	Built circa 1904, we are advised.
-----	-----------------------------------

	Weather	Overcast but dry.
--	---------	-------------------

Chimney stacks	Visually inspected with the aid of binoculars where appropriate.
	The chimney stacks are of pointed stone.

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe

Roofing including roof space	and reasonable to do so.
	The roof is of a mansard design with a flat upper section which appears to be clad in lead or similar with slate clad sections to the front and rear. There are two dormer projections to the front with slate coverings and what appears to be metal clad roofs. There is no roof void to access. We gained access to an eaves
	service void to the rear of the property only.

Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	Cast iron rainwater goods.

Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	Walls are formed in a traditional solid stone construction, pointed externally.

Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Windows are predominantly of a uPVC double glazed design.
	There are roof light windows to the upper floor with a mixture of timber and double glazed inserts.
	The main entrance door is of timber. A composite double glazed door is installed to the rear.

External decorations	Visually inspected.
	Painted finishes.

Т

Conservatories / porches	Not applicable.
Communal areas	Not applicable.
Garages and permanent outbuildings Not applicable.	

Outside areas and boundaries	Visually inspected.
	Garden is to the front, sides and rear of the property. Boundaries are formed in pointed stone walls and timber fencing.
	The property is accessed over a potentially private, shared access road.

Ceilings	Visually inspected from floor level.
	Ceilings appear to be predominantly of lath and plaster although sections of plasterboard are likely to exist.

Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal walls are mainly plastered masonry.

Floors including sub floors	Floors are mainly of a suspended timber design although sections
	of solid concrete were observed to the ground floor. We gained no access to any sub-floor area due to the absence of a visible hatch. Fitted floor coverings where installed were not lifted or moved.

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The kitchen is fitted with a range of floor and wall mounted units.
	Internal doors and joinery are of timber.

Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	All fireplaces have been blocked over with the exception of the living room which is fitted with a gas fire.

Internal decorations	Visually inspected.
	Painted, papered, tiled and 'wet wall' panelling finishes noted.

Cellars	Not applicable.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply of electricity. The meter and consumer unit are located within an entrance hallway cupboard.

Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains supply of gas. The meter is located externally.

Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Mains supply of water. Visible pipework is of PVC and copper.
	The main bathroom is fitted with a bath, wc and wash-hand basin.
	The ground floor shower room is fitted with a shower cubicle with wc and wash-hand basin.


Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	The property is fitted with a gas fired boiler located in a first floor utility cupboard. This serves radiators and provides hot water on demand.

Drainage	Drainage covers etc were not lifted.
	Neither drains nor drainage systems were tested.
	Drainage we understand connects to the main public sewer.

Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	We noted smoke detectors within the property.
	Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

Any additional limits to inspection	For flats / maisonettes
	Only the subject flat and internal communal areas giving access to the flat were inspected.
	If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.
	The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.
	Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.
	We have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation we have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.
	Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.
	The report does not include an asbestos inspection. However, asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos-based products has been reported within the limitations of the inspection, and you have concerns, you should engage a qualified asbestos surveyor.
	The property was occupied, fully furnished and floors were covered. Floor coverings restricted the inspection of flooring.
	In accordance with Health and Safety guidelines, we have not disturbed insulation, furniture or personal effects (particularly in cupboards).
	Personal effects in cupboards and fitted wardrobes were not moved and restricted the inspection.
	The external inspection of the property was undertaken from ground level only, the position of other properties and boundaries limited the inspection, and some parts were not visible. The inspection of the roof and chimneys was particularly limited.
	The flat roof coverings were not visible from ground level.
	We were not able to inspect the sub floor area due to the absence of a visible hatch and fitted floor coverings throughout.
	We did not test all windows. Windows were tested at random.
	Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly, with resultant damage to concealed parts of the fabric.
	Where repairs are required at height, compliance with Health and Safety legislation often requires the use of scaffolding, which can significantly impact on the cost of repair. Pricing repairs is out with

Any additional limits to inspection	the remit of this report, but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.
	It was not raining at the time of the inspection, and we therefore cannot assess the adequacy of the rainwater goods.

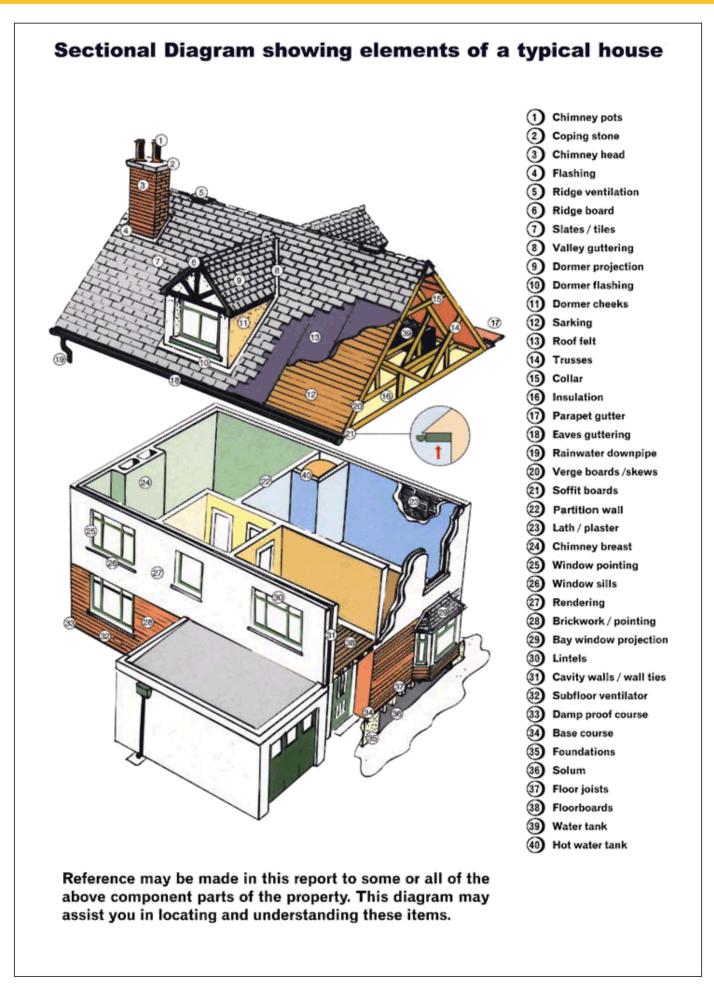

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Dampness, rot and infestation	
Repair category	1
Notes	Within the limitations of the inspection we noted no obvious evidence of any significant damp, rot or infestation although it must be appreciated the property is of an age where concealed defects can and do occur to hidden parts of the property.

Chimney stacks	
Repair category	2
Notes	Repointing and repairs to cracked pots are required. Stonework is weathered. Chimney stacks in a property of this age generally attract higher levels of maintenance and upkeep. Ongoing repair and maintenance should be expected and a competent roofer can advise further.

Roofing including roof space	
Repair category	2
Notes	Chipped and damaged slates noted to the roof covering. Within the rear service void staining was apparent to roofing timbers. We were unable to see the flat roof covering from ground level. Flat roofs can fail unexpectedly. Future and ongoing repair and maintenance should be anticipated and a roofing contractor can provide further advice.

Rainwater fittings	
Repair category	2
Notes	Corroded sections evident. Metal rainwater fittings require regular and ongoing maintenance.
	Rainwater fittings should be checked during rainfall to ascertain their adequacy and any required adjustments should be made.

Main walls	
Repair category	2
Notes	Areas of cracked pointing and stone noted. Repointing works are required. Stonework is weathered. A competent builder can advise as required.

Windows, external doors and joinery	
Repair category	2
Notes	Failed double glazing units noted, indicated by moisture/misting to the double- glazing units. A competent contractor can replace glazing as required.

External decorations	
Repair category	1
Notes	Regular repainting and maintenance should be expected to external timbers.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	-
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	-
Notes	Not applicable.

Outside areas and boundaries	
Repair category	2
Notes	Maintenance works to the boundary walls are required.

Ceilings	
Repair category	1
Notes	Localised areas of lath and plaster cracking were evident to ceilings and behind papered finishes. If plaster starts to pull loose from the lath, cracking can become widespread. Small cracks in this type of ceiling can develop into a larger repair.

Internal walls	
Repair category	1
Notes	No significant defects evident.

Floors including sub-floors	
Repair category	1
Notes	It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.

Internal joinery and kitchen fittings	
Repair category	1
Notes	Glazed inserts cannot be confirmed to be formed in toughened safety glass.

Chimney breasts and fireplaces	
Repair category	1
Notes	The gas fire should be checked by a suitably qualified contractor before use, in the interest of safety.

Internal decorations	
Repair category	1
Notes	No significant defects evident.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	2
Notes	The electrical installation is of a mixed age. A competent electrician can advise further and upgrade if required.
	It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.

Gas	
Repair category	1
Notes	Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

F Water, plumbing a	nd bathroom fittings
Repair category	1
Notes	Ongoing maintenance to sealant and grout around sanitary fittings is to be expected. Failure to seals and/or grout can result in dampness/decay in hidden areas.
9 PRIVATE ROAD,	

► Water, plumbing and bathroom fittings	
Repair category	1
Notes	The property is of an age where lead pipework may have originally been used in the construction. If identified during future exposure works, a plumbing contractor can remediate/replace as necessary.

Heating and hot water	
Repair category	1
Notes	It is assumed that the central heating system has been properly installed and maintained to meet with all relevant regulations, particularly in respect of flue and ventilation requirements.
	Boilers and central heating systems should be tested and serviced by a Gas Safe registered contractor on an annual basis to ensure their safe and efficient operation.

Drainage	
Repair category	1
Notes	No significant defects evident.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

	1
Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	2
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and First.
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The property is accessed over a private/shared road and we assume a satisfactory arrangement exists for maintenance and access.

The property is situated in an area of past mining activity. A mining report should be obtained from the Coal Authority to provide information as to historic and future mining activity and whether or not the property has been the subject of any compensation claims.

Internal alterations have been undertaken to the ground floor. We understand these were undertaken in approximately 2012. It is assumed all necessary consents and permissions are in place.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

Estimated reinstatement cost for insurance purposes

It is recommended the property be insured on a reinstatement basis for a figure not less than £750,000 (SEVEN HUNDRED AND FIFTY THOUSAND POUNDS).

The property is outside of standard BCIS calculations and the above figure should be treated as a guide only.

Valuation and market comments

In our opinion, the current market value of the above property in present condition would be fairly stated in the sum of £460,000 (FOUR HUNDRED AND SIXTY THOUSAND POUNDS).

Against a backdrop of changing economic circumstances it is not possible to predict how the market will perform in the coming months although market conditions appear to be stable at present.

Signed	Security Print Code [466565 = 5860] Electronically signed

Report author Cha	arlie Barrett	

Company name DM Hall LLP

Address 17 Corstorphine Road, Edinburgh, EH12 6DD	
---	--

 Date of report
 9th February 2024

Mortgage Valuation Report



Property Address	
Address Seller's Name Date of Inspection	9 PRIVATE ROAD, GOREBRIDGE, EH23 4HG Mr & Mrs Fuchs 5th February 2024
Property Details	
Property Type	X House Bungalow Chalet Purpose built maisonette Coach Studio Converted maisonette Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style	X Detached Semi detached Mid terrace End terrace Back to back High rise block Low rise block Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	lieve that the property was built for the public sector, Yes X No ilitary, police?
Flats/Maisonettes only	y Floor(s) on which located No. of floors in block Lift provided? Yes No
Approximate Year of (No. of units in block Construction
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
Number of Rooms	2 Living room(s) 4 Bedroom(s) 1 Kitchen(s) 2 Bathroom(s) 0 WC(s) 1 Other (Specify in General remarks)
	cluding garages and outbuildings) 164 m ² (Internal) 189 m ² (External)
Residential Element (greater than 40%) X Yes No
Garage / Parking / G	Outbuildings
Single garage Available on site?	Double garage Parking space X No garage / garage space / parking space Yes No
Permanent outbuilding	gs:
None.	

Mortgage Valuation Report

Construction								
Walls	Brick	X Stone	Concre		ber frame Icrete block	Othe	er (specify in Ger	neral Remarks)
Roof	Tile X Lead	X Slate	Asphal		glass fibre	Othe	er (specify in Ger	neral Remarks)
Special Disks								
Special Risks			e mt O					□
Has the property s If Yes, is this rece			ent?				X Yes	No X No
Is there evidence, immediate vicinity	history, or re		ipate subsider	nce, heave,	landslip o	r flood in th		X No
If Yes to any of th	e above, prov	ide details in	General Rem	arks.				
Service Connec	tion							
Based on visual ir		/ If any servi	ces annear to	he non-mai	ns nleasa		on the type a	nd location
of the supply in G			ces appear to	be non-mai	ns, pieast	econinent	on the type a	
Drainage	X Mains	Private	None		Water	X Mains	Private	None
Electricity	X Mains	Private	None		Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None					
Brief description of	of Central Hea	iting:						
The property is f	itted with a g	as fired boiler	r which serves	radiators a	nd provide	es hot wate	r.	
Site								
Apparent legal iss	ues to be ver	ified by the c	onvevancer F	lease provi	de a brief	description	in General R	emarks
Rights of way	X Shared driv	•	_ ·	her amenities		· —	ared service con	
Agricultural land in			III-defined bo				er (specify in Ge	
Location								
Residential suburb	Re	sidential within to	own / city 📃 I	Mixed residenti	al / commer	cial 🗌 Mai	nly commercial	
X Commuter village	Re	mote village		solated rural p	roperty	Oth	er (specify in Ge	eneral Remarks)
Planning Issues	S							
Has the property I	been extende	d / converted	I / altered?	Yes X N	0			
If Yes provide det	ails in Genera	al Remarks.						
Roads								
Made up road	Unmade roa	d Partly	completed new r	oad P	edestrian a	ccess only	Adopted	X Unadopted

Mortgage Valuation Report

General Remarks

The property is within an established residential area, convenient for local facilities and amenities.

The property is in typical order for age and type and regular repair and upkeep works should be expected.

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

The property is accessed over a private/shared road and we assume a satisfactory arrangement exists for maintenance and access.

The property is situated in an area of past mining activity. A mining report should be obtained from the Coal Authority to provide information as to historic and future mining activity and whether or not the property has been the subject of any compensation claims.

Internal alterations have been undertaken to the ground floor. We understand these were undertaken in approximately 2012. It is assumed all necessary consents and permissions are in place.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

Essential Repairs

In our opinion no essential repairs are required for the purposes of mortgage loan security.

Estimated cost of essential repairs £	Retention recommended?	X No	Amount £
---------------------------------------	------------------------	------	----------

Mortgage Valuation Report

Comment on Mortgageability

Subject to normal lending criteria, the property generally forms suitable security for mortgage lending purposes.

Valuations	
Market value in present condition	£ 460,000
Market value on completion of essential repairs	£
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 750,000
Is a reinspection necessary?	Yes X No
Buy To Let Cases	
What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis?	£
Is the property in an area where there is a steady demand for rented accommodation of this type?	Yes No
Declaration	

Signed	Security Print Code [466565 = 5860] Electronically signed by:-
Surveyor's name	Charlie Barrett
Professional qualifications	BSc (Hons) MRICS
Company name	DM Hall LLP
Address	17 Corstorphine Road, Edinburgh, EH12 6DD
Telephone	0131 624 6600
Fax	0131 624 6609
Report date	9th February 2024

PROPERTY QUESTIONNAIRE





Property address	9 Private Road, Gorebridge, EH23 4HG

Seller(s) Joseph R Fuchs, Susan Fuchs

Completion date of property questionnaire	7 th February 2024
questionnaire	

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership					
	How long have you owned the property? 35 years					
2.	Council tax					
	Which Council Tax band is your property in? (Please tick one) \Box A \Box B \Box C \Box D \Box E \Box F \Box G \Box H					
з.	Parking					
	What are the arrangements for parking at your property? (Please tick all that apply)					
	• Garage					
	Allocated parking space					
	• Driveway					
	Shared parking					
	On street					
	Resident permit					
	Metered parking					
	Other (please specify):					
4.	Conservation area					
	Is your property in a designated Conservation Area (that is ar special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	area of 🗌 Yes 🖾 No 🗌 Don't know				

5.	Listed buildings			
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	□ Yes ⊠ No		
6.	Alterations/additions/extensions			
а.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	⊠ Yes □ No		
	If you have answered yes, please describe below the changes which you have made:			
	We knocked through the wall seperating an old kitchen and cloak room to create an L shaped bedroom and separate bathroom. As part of the works a steel beam was inserted into the ceiling.			
	The hot water storage tank and cold water storage tanks were also removed from the kitchen and upstairs cupboard respectively and a combi boiler put in to replace them.			
	We obtained a building warrant and planning permission.			
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	Yes No		
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.			
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:			
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	Yes		
	If you have answered yes, please answer the three questions below:			
	(i) Were the replacements the same shape and type as the ones you replaced?	□ Yes ⊠ No		
	(ii) Did this work involve any changes to the window or door openings?	□ Yes ⊠ No		
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):			
	The windows downstairs were installed approx 20 years ago. T the sitting room and dining room are not the same shape as th windows (the originals were curved at the top whereas the new rectangular).	e original		
	Please give any guarantees which you received for this work to your s	olicitor or estate		

agent.

7.	Central heating				
а.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). <u>If you have answered yes or partial</u> – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm	⊠ Yes □ No □ Partial			
	 air). Gas fired central heating, combi boiler <u>If you have answered yes</u>, please answer the three questions below: (i) When was your central heating system or partial central heating system installed? 				
	 Prior to us buying the house. The boiler however was replaced round a (ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company with which you have a maintenance contract: We pay a monthly fee to have British Gas service and maintain the boiler. 	Yes			
	provide the month				
8.	Energy Performance Certificate				
	Does your property have an Energy Performance Certificate which is less than 10 years old?	☐ Yes ⊠ No			
9.	Issues that may have affected your property				
а.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it? <u>If you have answered yes</u> , is the damage the subject of any outstanding insurance claim?	 ☑ Yes ☑ No ☑ Yes ☑ No 			
b.	Are you aware of the existence of asbestos in your property? If you have answered yes, please give details:	☐ Yes ⊠ No			

10.	Services						
a. Please tick which services are connected to your property and give details of the supplie							
	Services						
	Gas or liquid petroleum gas	Yes	Octopus				
	Water mains or private water supply	Midlothian C	ouncil				
	Electricity Yes Octopus						
	Mains drainage Yes Midlothian Council						
	Telephone	Yes	Sky				
	Cable TV or satellite	Yes	Sky				
	Broadband	Sky					
		1					
b.	Is there a septic tank system a <u>If you have answered yes</u> , ple	□ Yes ⊠ No					
	(iv) Do you have appropria septic tank?	☐ Yes ☐ No ☐ Don't Know					
	(v) Do you have a mainter If you have answered yes, ple which you have a maintenance	☐ Yes ☐ No					

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? <u>If you have answered yes</u> , please give details: While the road is a private road and the majoirty of neighbours	☐ Yes ☐ No ⊠ Don't Know
	choose to contribute on occasion to its upkeep, to the best of our knowledge there is no legal responsibility to do so and is at the discrection of the owner.	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	☐ Yes➢ No☐ Not applicable
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	⊠ Yes □ No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?	⊠ Yes □ No
	If you have answered yes, please give details:	
	The access drive at the back of the property is shared by Number 7 and Number 9. We're unsure as to whether this falls within the boundaries of their property or ours.	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	□ Yes ⊠ No
	If you have answered yes, please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately- owned.) <u>If you have answered yes</u> , please give details:	□ Yes ⊠ No
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property? <u>If you have answered yes</u> , please provide the name and address, and give details of any deposit held and approximate charges:	□ Yes ⊠ No

b. с.	Is there a common buildings insurance policy? If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges? Please give details of any other charges you have to pay on a regular bupkeep of common areas or repair works, for example to a residents' a maintenance or stair fund.	 ☐ Yes ➢ No ☐ Don't Know ☐ Yes ☐ No ☐ Don't Know 	
13.	Specialist works		
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? <u>If you have answered yes</u> , please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	☐ Yes ⊠ No	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? <u>If you have answered yes</u> , please give details: We had a chemical damp proof course put in when we moved into the property 35 years ago.	⊠ Yes □ No	
с.	<u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work? <u>If you have answered yes</u> , these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below</u> <u>who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	☐ Yes ⊠ No	

14.	Guarantees						
a.	Are there any guarantees or warranties for any of the following:						
		No	Yes	Don't know	With title deeds	Lost	
(i)	Electrical work			\boxtimes			
(ii)	Roofing			\boxtimes			
(iii)	Central heating			\boxtimes			
(iv)	National House Building Council (NHBC)						
(v)	Damp course						
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)						
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):						
	There was a 30 guarantee for the damp proof course with Peter Cox but this expired in 2019. There is a 10 year guarantee for the back door with CR Smith. This expires on 27/09/2033 and covers the product, installation, security and a certificate that shows the work was in line with current building regulations. The guarantee passes to the new owners.						
с.	Are there any outstanding claims under any of the guarantees listed above?					☐ Yes ⊠ No	
	If you have answered yes, please give details:						
15.	Boundaries						
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:				☐ Yes ⊠ No ☐ Don't know		

16.	Notices that affect your property					
	In the past three years have you ever received a notice:					
a.	advising that the owner of a neighbouring property has made a planning application?	□ Yes ⊠ No				
b.	that affects your property in some other way?	□ Yes ⊠ No				
с.	that requires you to do any maintenance, repairs or improvements to your property?	□ Yes ⊠ No				
	<u>If you have answered yes to any of $a-c$ above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</u>					

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.



ABERDEEN aberdeen_residential@ dmhall.co.uk 01224 594172

AYR ayr@dmhall.co.uk 01292 286974

DUMFRIES dumfries@dmhall.co.uk 01387 254318

DUNDEE dundee@dmhall.co.uk 01382 873100

DUNFERMLINE dunfermline@dmhall.co.uk 01383 621262

EDINBURGH edinburghresidential@ dmhall.co.uk 0131 624 6600

ELGIN elgin@dmhall.co.uk 01343 548501

FALKIRK falkirk@dmhall.co.uk 01324 628321

GALASHIELS galashiels@dmhall.co.uk 01896 752009 GLASGOW (Residential) glasgowresidential@ dmhall.co.uk 0141 636 4141

HAMILTON hamilton@dmhall.co.uk 01698 284939

INVERNESS inverness@dmhall.co.uk 01463 241077

INVERURIE inverurie@dmhall.co.uk 01467 624393

IRVINE irvine@dmhall.co.uk 01294 311070

KIRKCALDY kirkcaldy@dmhall.co.uk 01592 598200

LIVINGSTON livingston@dmhall.co.uk 01506 490404 OBAN oban-admin@dmhall. co.uk 01631 564225

PAISLEY Enquiries are now dealt with at our Glasgow Hub.

PERTH perth@dmhall.co.uk 01738 562100

PETERHEAD peterhead@dmhall.co.uk 01779 470220

ST ANDREWS standrews@dmhall.co.uk 01334 844826

STIRLING stirling@dmhall.co.uk 01786 475785

